

MAR 29 1999

REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

LAPEER  
(County)

Located in:  
DRYDEN TWP

Corner Code # K-2

RECEIVED FOR RECORD

99 JAN -6 PM 1:03

*Melissa De Vaughn*  
REGISTER OF DEEDS  
LAPEER COUNTY, MICHIGAN

- |                                    |                          |            |
|------------------------------------|--------------------------|------------|
| 1. Public Land Survey              | T <u>6N</u> R <u>11E</u> | <u>K-2</u> |
|                                    | T ___ R ___              | _____      |
|                                    | T ___ R ___              | _____      |
|                                    | T ___ R ___              | _____      |
| 2. Property Controlling in Section | S ___ T ___ R ___        | _____      |
|                                    | S ___ T ___ R ___        | _____      |
| 3. Miscellaneous Property in Sec.  | S ___ T ___ R ___        | _____      |
|                                    | S ___ T ___ R ___        | _____      |

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Shelby W Money, in a field survey on October 8, 1998 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

- A. Description of original monument and accessories and/or subsequent restoration:  
1816-GLO Wampler, Set a 1/2 Mile Post on line between sec 1 & 2.
- L1, Pg 452 May 1972 survey by Henderson Bates, Found 1/2" iron.
  - L1, Pg 691 September 1972 survey by Henderson Bates, Found 1/2" iron.
  - L2, Pg 879 August 1974 by survey Henderson Bates, Found 1/2" iron.
  - L3, Pg 234 April 1975 survey by Kay Engineering, Found 1/2" iron.
  - L3, Pg 715 August 1976 survey by Kay Engineering, Found 1/2" iron.
  - L4, Pg 279 July 1977 survey by Henderson Bates, Corner not identified.
  - L4, Pg 331 October 1977 survey by Kay Engineering, Found 1/2" iron.
  - L5, Pg 668 March 1979 survey by Kay Engineering, Found 1/2" iron.
  - L4, Pg 849 July 1979 survey by Henderson Bates, Found 1/2" iron.
  - L5, Pg 251 February 1979 survey by Henderson Bates, Found 1/2" iron.
  - L6, Pg 428 September 1982 survey by Henderson Bates, Found 1/2" iron.
  - L1, Pg 181, April 1972 LCRC by Harold Elrich, Found 1/2" iron.
  - L2, Pg 135, November 1972 LCRC by Robert Mitchell, Found 1/2" iron.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" iron is .5 east of the physical centerline of Mill Road which extends north and south and has an asphalt surface. The following witnesses from recorded documents were found:

- West 27.3' to base of angle iron post.
- S 20° W 58.68' Nail & Tag Telephone pole.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-2 Placed 2" diameter brass cap stamped LAPEER COUNTY REMONUMENTATION, PS#30092 found 1/2" iron.

- Az 80° 27.03' to a nail found in north face of a 15" oak.
- Az 165° 99.42' to P. K. nail & Lapeer County Remon Tag set in west face of an 8" cherry.
- Az 235° 79.95' to P. K. nail & Lapeer County Remon Tag set in southeast face of an 8" maple.
- Az 300° 75.44' to P. K. nail & Lapeer County Remon Tag set in north face of a utility pole.
- Az 320° 37.66' to P. K. nail found in the southwest face of a utility pole


FIELD MEASUREMENTS

K-2 TO K-1 2844.50' GLO 2874.96' K-2 TO K-3 2637.02' GLO 2640.00'  
K-2 TO L-2 2673.98'

THE SELECTED LOCATION IS ACCEPTED BY ME AND IS GENERALLY ACCEPTED BY PROFESSIONAL SURVEYORS AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Shelby W Money  
Surveyor's Michigan License No. 30092

Date 12/22/98

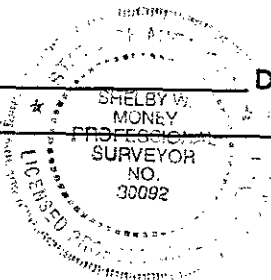

431

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

LAPEER GROUP  
APPROVED LAND CORNER  
PAGE 3 OF 1000  
LAPEER COUNTY

DATE 10-13-98