

SURVEY & REMONUMENTATION

APR 28 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lapeer	Located in:	Corner Code #
(County)	Almont Township	
1. Public Land Survey	T 6N R 12E	I-1
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

RECEIVED FOR RECORD

94 DEC 29 AM 10:18

LISER NO. 005 PAGE NO. 192

REGISTER OF DEEDS
LAPEER COUNTY MICHIGAN

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Shelby W. Money, in a field survey on 11-14, 1994 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

1. Joseph Wampler, D.S. in 1817 pages 556 - 560 set post. No witnesses left.
2. Gilbert Bates 1855 pages 82-83 Stone 30" - 9" - 8"
3. Unrecorded survey by Charles Getz P.S. 25843 on 11-17-82 as a found 1/2" iron, 2' North of fence.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" rebar 2' North of a fence line running East and West on the North side of a drain.

Witnesses: from item 3 above
S 10° W 15.56' Nail 10" Maple
N 70° W 14.60' Nail 10" Maple
N 15° W 45.17' Nail 36" Maple

Distances:
East to I-13 (Imlay Township) 457.59'
South to I-2 3030.77' (Bates 3088.80')
West to H-13 (Imlay Township) 2156.74'
East to J-1 2732.07' (Bates 2723.16')
West to H-1 2730.53' (Bates 2740.32')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Placed standard Lapeer County Remonumentation cap stamped "I-1 30092" on found 1/2" rebar.

Az 0° 46.69' Set PK with 17635 tag in South face of 36" Maple.
Az 100° 14.69' Set PK with 17635 tag in South face of 12" Ash.
Az 195° 14.70' Set PK with 17635 tag in Northeast face of 12" Maple.
Az 290° 14.70' Set PK with 17635 tag in South face of 15" Maple.

REGISTER GROUP
APPROVED LAND CORNER
PA 345 OF 1990
LAPEER COUNTY
RAY DAVIS P.S. CO. SURVEYOR
DATE 12-28-94

Signed by Shelby W. Money
Surveyor's Michigan License No. 30092

Date 12/29/94

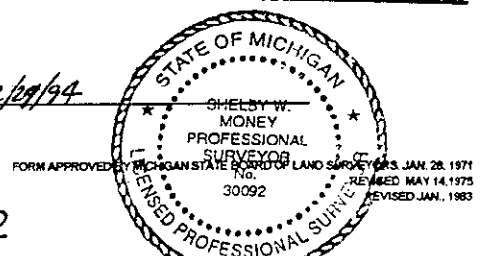

LISER 0005 PAGE 0192