

SECTION

MAR 29 1999

REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

LAPEER
(County)

Located In:
ATTICA TWP

Corner Code #

J-13

1. Public Land Survey

T 7N R 11E

J-13

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec.

S T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims

I, Shelby W Money

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner

points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Township south boundary surveyed in 1816 and 1822 by Wampler. A 1/2 Mile Post was set 40.00 chains east of southwest Corner of section 35 and 40.00 chains west of post common to sections 35 and 36 of T7N, R11E.

1. L3, Pg 60, September 1974 survey by Commonwealth Associates, set 1/2" iron.
2. L7, Pg 173, October 1985 survey by Earl Gravlin, Found iron.
3. L7, Pg 317 June 1986 survey by Earl Gravlin, Found iron.
4. L4, Pg 192, September 1987 LCRC by Harold Elrich, Found iron rod.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found 1/2" iron is 8 ft south of the physical centerline of Sutton Road, which has a gravel surface and runs east and west. Walker Road extends to the north and also has a gravel surface.

1. N 70° E 76.15' to power pole.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-13 Placed 2" diameter brass cap stamped LAPEER COUNTY REMONUMENTATION, PS#30092 on found 1/2" iron.

1. Az 75° 76.15' to P. K. nail found in south face of a utility pole.
2. Az 170° 22.53' to spike found in east face of a 8" aspen.
3. Az 270° 110.66' to P. K. nail & Lapeer County Remon Tag set in the north face a 14" poplar.
4. Az 300° 87.82' to nail w/tag # 32332, Gil Bono, found in south face of a utility pole.
5. Az 320° 75.91' to P. K. & Lapeer County Remon Tag set in the southwest face of a utility pole

FIELD MEASUREMENTS


J-13 TO K-1 (T6N, R11E) 1758.21'

J-13 K-13 2631.42', GLO 2640.00"

THE SELECTED LOCATION IS ACCEPTED BY ME AND IS GENERALLY ACCEPTED BY PROFESSIONAL SURVEYORS AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

Signed by Shelby W Money
Surveyor's Michigan License No. 30092

Date 11/10/98

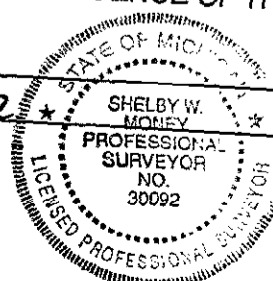

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1972
REVISED JAN., 1983
REVISED OCT. 1989

LIBER 0006 PAGE 0120

RECEIVED FOR RECORD
99 JAN -6 PM 1:23

Malina De Vaughn
REGISTER OF DEEDS
LAPEER COUNTY MICHIGAN

441

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4		3		2		1	
3													
4	7			8		9		10		11		12	
5													
6	18			17		16		15		14		13	
7													
8	19			20		21		22		23		24	
9													
10	30			29		28		27		26		25	
11													
12	31			32		33		34		35		36	
13													

APPROVED LAND CORNER
DATE OF 1998
LAPEER COUNTY

RAY DAVIS P.S. CO. SURVEYOR
DATE 10-13-98