

**SURVEY &
REMONUMENTATION**

APR 28 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

LAPEER
County

Located in:
IMLAY TOWNSHIP

Corner Code ##

- | | | |
|------------------------------------|--------------------------|------------|
| 1. Public Land Survey | T <u>7N</u> R <u>12E</u> | <u>M-6</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

RECEIVED FOR RECORD

95 JAN -3 PM 3:49

LIBER NO. 05 PAGE NO. 204

Nelson DeVaugh
REGISTER OF DEEDS
LAPEER COUNTY, MICHIGAN

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, JAMES T. BAILEY in a field survey on OCTOBER 17, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	0	1	2	3	4	5	6	7	8	9	10	11	12
3													
4	7	8	9	10	11	12							
5													
6	16	17	18	19	20	21	22	23	24	25	26	27	28
7													
8	19	20	21	22	23	24							
9													
10	30	31	32	33	34	35	36						
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. (1822) JOSEPH WAMPLER SET POST 5" BEECH N.67½°W. 19 LKS
5" TREE S. 56½°W. 20 LKS

SURVEY (1979) CHARLES S. GETZ P.S. UNRECORDED FD. 1½" PIPE 3 WITNESSES GIVEN
SURVEY (1991) JOHN A. MILLETICS P.S. UNRECORDED FD. 1½" PIPE NO WITNESSES GIVEN
SURVEY (1991) JAMES T. BAILEY P.S. UNRECORDED FD. 1½" PIPE 4 WITNESS GIVEN

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1994 JAMES T. BAILEY P.S. FOUND 1½" PIPE 3' WEST OF CENTERLINE OF CADE ROAD 6" BELOW GRADE. 1½" PIPE USED IN ALL PREVIOUS LISTED SURVEYS. FOUR PREVIOUS WITNESSES FOUND.

M-6 to L-6 BAILEY MEAS. 2642.10, MILLETICS MEAS. 2642.16, GETZ MEAS. 2642.16

ACCEPTED 1½" PIPE AS BEST LOCATION OF ORIGINAL POSITION OF THE EAST CORNER, SECTION 13, T7n - R12E, IMLAY TOWNSHIP.


APPROVED LAND CORNER
PA 345 OF 1990
LAPEER COUNTY

Ray Davis
RAY DAVIS P.S. CO. SURVEYOR

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: 1-3-95

M-6 SET ½" IRON ROD W/ STANDARD REMONUMENTATION CAP IN 1½" PIPE.

- N.35°W. 63.90 SET NAIL W/ REMON TAG IN E. FACE 18" ASH
- S.40°E. 72.63 SET NAIL W/ REMON TAG IN W. FACE 16" CATALPA
- S.25°W. 87.87 SET NAIL W/ REMON TAG IN E. FACE 18" ASH
- WEST 78.60 SET NAIL W/ REMON TAG IN N. FACE 12" OAK
- S.55°E. 41.10 FND. P.K. NAIL IN FENCE POST
- S.25°W. 87.64 FND NAIL & TAG #14097 IN N.W. FACE 18" ASH
- S.40°E. 72.61 FND 16 "D" NAIL IN W. FACE 16" CATALPA

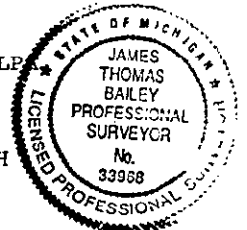

Signed by *James Bailey* Date DECEMBER 29, 1994

Surveyor's Michigan License No. 33968