

MAR 23 2000

REMONUMENTATION

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Lapeer</u> (County)	Located In: Goodland Twp.	Corner Code # <u>K-9</u>
1. Public Land Survey	T 8N R 12E	<u>K-9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

RECEIVED FOR RECORD

99 DEC 14 AM 9:13

Melissa ...
REGISTER OF DEEDS
LAPEER COUNTY, MICHIGAN

513

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A B C D E F G H I J K L M

1						
2	6	5	4	3	2	1
3						
4	7	8	9	10	11	12
5						
6	18	17	16	15	14	13
7						
8	19	20	21	22	23	24
9						
10	30	29	28	27	26	25
11						
12	31	32	33	34	35	36
13						

I, Earl E. Gravlin, in a field survey on July 22 19 99, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO: 1824 Lyon, set post, beech 8 N65W 6, beech 8 S76E 19. County Surveyor: nothing. 1997 Gravlin L12 P98, fnd 3/4" pipe 3' +/- W cl road, W 43.80' S side PK nail pp, N50E 46.90' SW cor tele ped, S45E 43.80' road name sign. 1997 Rowe L12 P590, fnd 3/4" pipe, West 43.8' PK pp, N30E 47.1' SW cor t. ped, S45E 44.12' rd name sign, S80E 55.54' S edge sign post. 1997 Kay job #97-20, found 3/4" steel stake, West 43.75' PK nail in pp, N60E 47.70' PK nail tp, N45E 46.63' 1/2" iron. Unrecorded surveys: none. Act 74: none.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found 3/4" pipe 3' W of centerline of road North South and 3' South centerline of road to East and on fence line to West witness match above surveys except sign is gone (Rowe)
K-9 to K-8 2635.47'
K-9 to L-9 2609.61'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-9 Section corner common to 23, 24, 25, 26
Removed 3/4" pipe
Set standard brass cap on 1/2" iron.
N60E 47.48' nail and tag in West side telephone post
N76E 53.41' leg stop sign
S15E 99.15' nail and tag in West side 14" oak
S19W 57.26' nail and tag in East side 6" elm
S89W 43.81' nail and tag in South side power pole
N13E 94.56' nail and tag in West side 8" elm

PEER GROUP
APPROVED LAND CORNER
PA 245 OF 1990
LAPEER COUNTY

RAY DAVIS P.S. CO. SURVEYOR
DATE 10-21-99

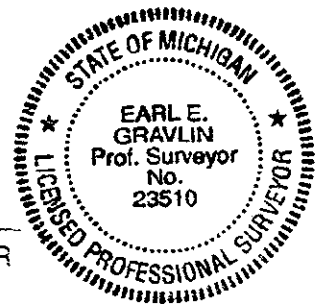

Signed by [Signature]
Surveyor's Michigan License No. 23510

Date DEC 3, 1999

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

REVISED MAY 24, 1975
REVISED JAN. 1983
ADAPTED FOR WORD PROCESSING MARCH, 1983