

**SURVEY &
REMONUMENTATION**

APR 29 1996

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970
1995 REMONUMENTATION PROGRAM

RECEIVED FOR RECORD

95 DEC 13 AM 8:53

For corners in MARATHON TWP.

LIBER NO. 5 PAGE NO. 314

LAPEER
(County)

Located In:

Corner Code #

Melissa DeVaugh
REGISTER OF DEEDS
LAPEER COUNTY, MICHIGAN

| | | | | | |
|------------------------------------|---|-----|---|-----|-----|
| 1. Public Land Survey | T | 09N | R | 09E | M-5 |
| | T | | R | | |
| | T | | R | | |
| | T | | R | | |
| 2. Property Controlling in Section | S | T | R | | |
| | S | T | R | | |
| 3. Miscellaneous Property in Sec. | S | T | R | | |
| | S | T | R | | |

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|----|----|----|----|----|---|---|---|---|---|---|---|
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | | |
| 3 | | | | | | | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | | |
| 5 | | | | | | | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | | |
| 7 | | | | | | | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | | |
| 9 | | | | | | | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | | |
| 11 | | | | | | | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | | |
| 13 | | | | | | | | | | | | | |

I, JONATHAN M. FIELD, in a field survey on MARCH 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 1852 GLO; WAMPLER, D.S.; SET POST; BEECH 7 N7 1/2W 23 1/2LKS., BEECH 5 SBOW 15LKS.
 1906 SICKLESTEEL, C.S.; SURVEY OF SEC.12; STAKE & GLASS; PINE STUMP 36 S12W 146LKS., PINE STUMP 36 N3W 37 LKS.
 1979 BECK-GRAVLIN; BECK, P.S.#21559; SURVEY L.5, PG.596-599; FND 1/2" PIPE; S40W 74.3' MSHD TAG IN P.POLE, S55E 54.7' NW FACE P.POLE, N30E 32.7' CENTER 28" OAK
 1988 HENDERSON-BATES; ELRICH, P.S.#18986; SURVEY L.8, PG.61-63; FND 1/2" PIPE; SAME WITS AS 1979 SURVEY ABOVE EXCEPT S45W 74.15' MSHD TAG IN P.POLE

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 1995 ROWE ENG.; FIELD, P.S.#37276; FND 3/4" PIPE AT C/L EXTENDED OF GRAVEL ROAD N. & W., TREE/BRUSH ROW TO S.
 PEER GROUP

G.L.O. NOTES FOR T9N-R10E INDICATE THAT THIS CORNER IS NOT COMMON WITH A-5, T9N-R10E


APPROVED LAND CORNER
LAPEER COUNTY

Ray Davis
RAY DAVIS P.S. CO. SURVEYOR
DATE 7-13-95

M-5 TO M-4 2632.60' (BECK 1979)

ACCEPTED FND PIPE AS A CAREFUL AND FAITHFUL PERPETUATION OF THE ORIGINAL CORNER POSITION

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 M-5 SET 1/2" X 18" ROD W/ STANDARD BRASS CAP INSIDE FND. 3/4" PIPE
 N40°E, 32.69' FND. NAIL IN SE FACE 34" MAPLE
 S75°E, 27.49' FND. NAIL IN S. FACE 34" MAPLE
 S40°W, 74.10' FND. NAIL W/ MSHD TAG IN SE FACE P.POLE
 S60°E, 54.92' SET P-K NAIL W/REMON TAG IN SE FACE P.POLE

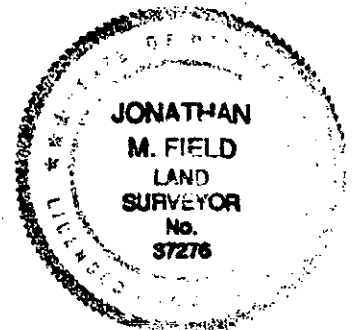

Signed by *Jonathan M. Field*
Surveyor's Michigan License No. 37276

Date 12-1-95