

# SURVEY & REMONUMENTATION

APR 28 1995

COMMISSION

## 1994 REMONUMENTATION PROGRAM LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED FOR RECORD

94 DEC 22 PM 2:08

LIBER NO. 05 FILE NO. 184  
*Nelson J. Laugh*  
REGISTER OF DEEDS  
LAPPEER COUNTY, MICHIGAN

For corners in RICH TWP. LAPPEER (County)	Located In:	Corner Code #
1. Public Land Survey	T 10N R 10E	K-13
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling In Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, JONATHAN M. FIELD, in a field survey on SEPTEMBER 23 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:  
 1834 GLO; PARKE, D.S.; SET POST; BEECH 9 N55E 18LKS., BEECH 6 N25W 11LKS.  
 1905 SICKLESTEEL, C.S.; STAKE; PINE 44 S85E 31LKS., PINE 32 N56W 108LKS.  
 1972 HENDERSON-BATES; ELRICH, P.S.#18986; SURVEY L.1, PG.340; NO OBJECT STATED; NO WITS GIVEN  
 1989 GRAVLIN, P.S.#23510; SURVEY L.8, PG.202; FND NO EVIDENCE OF SW COR SEC.36 (BRUSH ROW EXTENDED IS 12'+/- W. OF K-1 T9N-R10E)


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 1994 ROWE ENG.; FIELD, P.S.#37276; FND NO EVIDENCE OF MONUMENT AT CORNER; FND 5/8" ROD IN MON. BOX AT APPARENT K-1 T9N-R10E AT C/L FISH LK. RD. TO S.; EXTENSION OF FENCE LINE TO N. IS 11.5'+/- W. OF MON. BOX; GLO NOTES OF T9N-R10E INDICATE THAT CORNER K-1 WAS SET 46LKS. (30.36') E. OF CORNER K-13 T10N-R10E

SET 1/2"X 18" ROD AT THE INTERSECTION OF OCCUPIED FENCE LINE EXTENDED FROM N. AND LINE BETWEEN APPARENT J-13 T10N-R10E (FND 1/2" PIPE IN MON. BOX) & APPARENT K-1 T9N-R10E (FND 5/8" ROD IN MON. BOX) CORNER POSITION FALLS ON C/L ASPH. ROAD E-W

2632.41' K-13 TO L-13 (MEAS. BY OTHERS)  
 2631.06' K-13 TO APPARENT J-13

ACCEPTED AS A CAREFUL AND FAITHFUL REESTABLISHMENT OF THE ORIGINAL CORNER POSITION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 K-13 SET 1/2"X 18" ROD W/ STANDARD BRASS CAP IN MON. BOX  
 S60°E, 82.40' SET NAIL W/REMON TAG ABOVE FND NAIL W/MSHD TAG IN NE FACE P. POLE  
 N40°E, 29.17' SET CHIS. NOTCH IN TOP W. END 12" CSP  
 N65°E, 47.71' SET CHIS. NOTCH IN TOP E. END 12" CSP  
 S45°E, 70.83' SET CHIS. NOTCH IN TOP E. END 18" CSP  
 S15°W, 61.04' SET CHIS. NOTCH IN TOP W. END 18" CSP  
 EAST, 11.31' FND 5/8" ROD IN MON. BOX AT C/L ASPH. ROAD TO S.

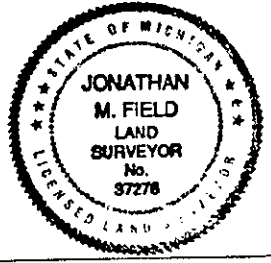

PEER GROUP  
 APPROVED LAND CORNER  
 Signed by [Signature]  
 Surveyor's Michigan License No. 37276

Date 12-8-94

RAY DAVIS P.S. CO. SURVEYOR  
 DATE 12-22-94

LIBER 005 PAGE 0184