

SURVEY & REMONUMENTATION

APR 28 1995

COMMISSION

REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED FOR RECORD

94 NOV 18 PM 2:00

LIBER NO. 05 TRAC NO. 120
Richard J. Smith
REGISTER OF DEEDS
LAPPEER COUNTY MICHIGAN

For corners in	Located In:	Corner Code #
Lapeer <small>County</small>		
1. Public Land Survey	T 10N R 12E	M-9
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Earl E. Gravlin, in a field survey on September, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

Wampler 1822, Set Post, HEMLOCK 18 S 27 W 18, BEECH 5 N 39 E 12, BURT 1834 INT 69 LINKS N, CORRECTED, ASH 17 N 51 E 41, ELM 16 S 55 E 51. ACT 74 FORMS L 1, P 157 SWARTS 1974, FND STONE, SET 1/2" IRON AT SURFACE, N 50° E 35.7' STUMP, S 50° E 109' PP, S 50° W 40.5' COR. POST, N 40° W 33.8 TELE RISER. ACT 132 FORMS L 4, P 806, SANILAC CTY RECORDS, KAY, FND 1/2" IRON, N 45° E 44.30' NAIL 6" APPLE, S 35° W 45.85' NAIL WOOD POST, S 50° W 40.5' COR. POST

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Flat land, gravel road North-South, gravel road East-West. Found 1/2" Iron. M-9 to M-10 2573.27' M-9 to M-8 2640.12 M-9 to A-10 2606.27

PEER GROUP
APPROVED LAND CORNER
PA 345 OF 1990
LAPPEER COUNTY

Ray Davis
RAY DAVIS P.S. CO. SURVEYOR
DATE 11-13-94

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found 1/2" Iron, Set Brass Cap
S 43° 51' W 40.96" NAIL AND TAG N/S WOOD COR. POST
N 39° 11' W 41.88' NAIL AND TAG E/S 4x4 WOOD POST
S 58° 42' E 108.90' NAIL AND TAG N/S NAIL IN POWER POLE
N 72° 52' E 36.75' NAIL AND TAG WEST FACE STOP SIGN

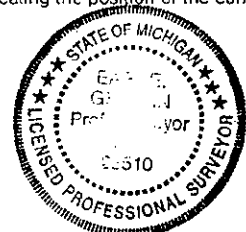

Signed by _____ Date 11/12/94
Surveyor's Michigan License No. 25510