

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>32</u> N. <u>•</u> R. <u>10</u> W. <u>•</u>	A-5; A-6
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ E. _____ S. _____ R. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION <u>18</u>	T. <u>32</u> N. <u>•</u> R. <u>10</u> W. <u>•</u>	XX = 966.7' N of A-6
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970 the corner points mentioned in lines 1 and 2 above were, in a field survey on October 29, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on October 29, 1979, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-5 Fd. square concrete monument for NW corner of Sec. 18 T32N-R10W, per survey by H. H. Brehmer, Co. Surveyor, 1951. Corner falls in deep E-W ravine. The NE corner of Sec. 13 T32N-R11W is S01°13'44"W, 331.07'.
- A-6 Fd. square concrete monument for W 1/4 corner of Sec. 18 T32N-R10W per survey by H. H. Brehmer, Co. Surveyor, 1951. The E 1/4 corner of Sec. 13 T32N-R11W is S01°13'00"W, 330.11'.
- XX Fd. sq. conc. mon. for NW corner of S 28.75 acres of W frl 1/2 of NW frl 1/4 of Sec. 18, T32N-R10W per survey by Brehmer, Co. Surveyor, 1951. N 1/8 corner on E line of Sec. 13 T32N-R11W (sq. conc. mon. Brehmer 1951) is N01°13'10"E 37.97'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-5	A-6	XX
Fd. sq. conc. mon. & set cedar post w/loc. tag	Fd. sq. conc. mon. & added cedar post w/loc. tag	Fd. sq. conc. mon. & added cedar post w/loc. tag
12" Maple N60°E 34.3	18" W. Pine S50°E 3.68	15" Beech S23°W 17.63
15" Maple S50°E 22.57	13" Hemlock N57°E 9.36	6" W. Birch N73°W 22.26
14" Maple S14°W 34.87	16" Hemlock S60°W 6.19	10" Maple N75°E 32.37
16" Dead Maple N20°E 17.24		


SIGNED BY Carl F. Roser 5-14-80 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

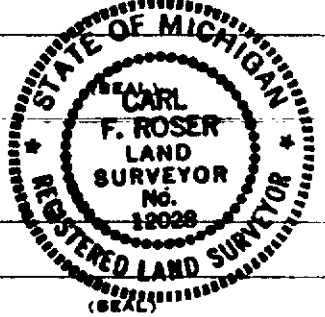

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ LEELANAU TOWNSHIP
LEELANAU COUNTY