

APR 01 1996

Filed under Remonumentation Act 345 of 1990

LIBER 001 PAGE 85

LAND CORNER RECORDATION CERTIFICATE

COMMISSIONER

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee
(County)

Located In:

Corner Code #

- 1. Public Land Survey T - 7 - S R - 2 - E M-12
 T _____ R _____
 T _____ R _____
 T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
 Property in Sec. S _____ T _____ R _____

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Glenn E. Richard, in a field survey on September 13, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


G.L.O., February 1824, John Mullett set 1/4 section post W. Wood 14 S 45 W 28 Elm 10 North 14 1963, W.E. Sommer found "square iron" December 1975, W.E. Sommer found large bolt and recorded it in L. 3, P. 73

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

September 13, 1995, Dug through new pavement and found 1/2" X 12" iron pipe over 2 3/8" X 2 3/8" X ? square top on a 1 1/4" iron bar. Couldn't get it all of the way out of the ground so left it. Cut "X" in Center of top and set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

2 3/8" X 2 3/8" "square topped" iron bar in monument box and is accepted as the best available evidence of the position of the original corner.
 Dbl. hd. nail & disc in NE. side 32" Maple N 30° W 32.25
 Dbl. hd. nail & disc in root S. side 36" Maple N 65° W 94.92
 SE. Corner of house foundation next to porch N 40° W 96.15
 Steel rod in face of concrete post N 5° E 23.65
 Dbl. hd. nail & disc on S. side 18" dbl. Oak N 85° E 109.98

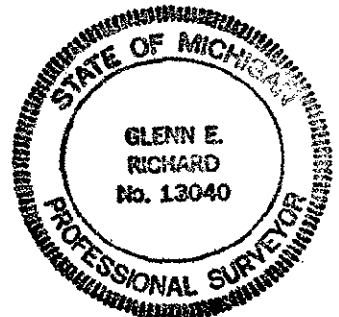

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date October 19, 1995

Signed by Glenn E. Richard Date Nov. 3, 1995
 Glenn E. Richard

Surveyor's Michigan License No. 13040

FILED
 NOV 22 1995
 11:56 AM
 LENAWEЕ COUNTY
 JEANETTE D. KNOX
 REGISTER OF DEEDS
 Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													