

Filed under Remonumentation Act 345 of 1990  
**LAND CORNER RECORDATION CERTIFICATE** LIBER 1 PAGE 175  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Lenawee (County) Located in: Corner Code #

1. Public Land Survey	T - 8 - S	R - 2 - E	K-7
	T	R	
	T	R	
	T	R	
2. Property Controlling in Section	S	T	R
	S	T	R
3. Miscellaneous Property in Sec	S	T	R
	S	T	R

STATE OF MICHIGAN  
 LENAWEE COUNTY  
 FILED  
 8 JUL 97 1:02 P.M.  
 VICTORIA J. DANIELS  
 REGISTER OF DEEDS  
 Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Glenn E. Richard, in a field survey on April 3 19 97, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management, or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2								
3													
4	7	6	5	4	3	2							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:  
 G.L.O. 1824, John Mullett set post corner Sections 13, 14, 23 & 24 Lynn 26 516 E 18 Maple 12 N 15 W 20  
 1886 James Blair found drag tooth & bricks.  
 1961 I dug through the pavement and found iron pipe and bricks 2.5 deep and raised to surface with 1" X 16" iron bar.  
 1972 I found the 1" iron bar in the pavement and recorded it in Liber 1, Page 525.  
 Nail & disc in 15" walnut N 20 W 98.03  
 Nail & disc in E.P. N 40 W 38.93  
 Steel sign post S 60 W 32.20  
 1993 The Road Commission set a monument box during the reconstruction of Weston Road.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 April 3, 1997. I found the 1" X 16" iron bar in a monument box but leaning to the south. Dug 2.5 deep inside of monument box and found iron pipe and bricks. Set 3/4" x 3' gas pipe on top of the found iron pipe and drove both of them down.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 3/4" X 3' gas pipe capped G.E.R. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.  
 Fd. dbl. hd. nail & disc in east face of 18" walnut N 20 W 97.99  
 Fd. dbl. hd. nail & disc in northeast face of E.P. N 40 W 38.92  
 Face of 2" steel sign post in concrete S 60 W 32.16  
 " X " cut on N. end of C.M.P. N 50 E 41.29  
 " X " cut on S. end of C.M.P. S 65 E 34.47

**SURVEY & REMONUMENTATION**

**AUG 25 1997**

**COMMISSION**

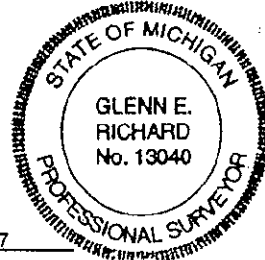

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date 6-3-97  
 Signed by Glenn E. Richard Date 6-9-97  
 Glenn E. Richard  
 Surveyor's Michigan License No. 13040