

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION



LIBER 1 PAGE 430

For corners in


Lenawee

(County)

Located In:

Corner Code #

- 1. Public Land Survey T-8-S R-4-E C-10
T R
T R
T R
- 2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec S T R

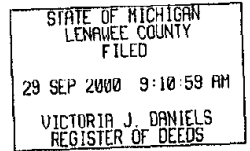

Register of Deeds Stamp & File Number

- 4. Lot No. Recorded Plat
- 5. Private Claims

I, Glenn E. Richard, in a field survey on September 7, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A B C D E F G H I J K L M

1														
2	6	5	4	3	2	1								
3														
4	7	8	9	10	11	12								
5														
6	18	17	16	15	14	13								
7														
8	19	20	21	22	23	24								
9														
10	30	29	28	27	26	25								
11														
12	31	32	33	34	35	36								
13														

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1820 Joseph Wampler set 1/4 Sec. post Ash 11 S 5 E 39 Ash 25 N 2 E 72
1878 Survey by G.E. Kedzie, County Surveyor, called for "stone corner"
1885 James Blair Iron & bricks & gov. stump S 5° E .39
No Date James Blair record "Stone & Iron and iron & bricks with iron plate over"
No Date Early 1900's J.L. Richard's record "Iron and bricks under iron plate"
1914 J.L. Richard found stake and tile
1976 Werner Sommer re-established the corner by retracing G.E. Kedzie's survey and set a RR spike in the pavement as there is now 6' of fill above the original ground elevation
1978 Werner Sommer found the RR spike and recorded it in Liber 4, Page 202
1995 Michael Bartolo found the RR spike 4" deep. Replaced the RR spike with a 1/2" iron pipe and recorded it in Liber 5, Page 251
1998 Found iron pipe which checked M.Bartolo witnesses

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

July 18, 2000 Found 1/2" iron pipe in stone road which checked the witnesses and replaced it with a 5/8" X 3' re-rod.
September 7, 2000 Found 5/8" re-rod under new pavement. Capped with Lenawee County Re-mon cap stamped P.S. 13040 and set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

Fd nail and disc in NW corner of Timber Bridge S 15° W 47.06
Fd nail and disc in NE corner of Timber Bridge S 15° E 46.70
Fd nail and disc in 48" Cottonwood N 50° E 71.71
Dbl hd nail & re-mon tag in 24" Ash S 50° E 59.19
The corner is 0.7 west of pavement centerline



Ratified by Peer Group in accordance with P.A. 345 Co. Reg. Glenn E. Richard Date September 26, 2000

Signed by Glenn E. Richard Date Sept 28, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040