

SURVEY & REMONUMENTATION

AUG 10 1998

SECTION

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE LIBER **1** PAGE **250**
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Lenawee</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T - 8-S R - 5 - E	A-3
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

STATE OF MICHIGAN
 LENAWEE COUNTY
 FILED

1 JUL 98 3:07 P.M.

VICTORIA J. DANIELS
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Glenn E. Richard, in a field survey on April 7, 19 98, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- G.L.O. 1820 Joseph Wampler set post Sugar 12 N 60 W 8 Lynn 20 S 15 W 7
- 1882 James Blair found stake with stones on east side
- 1928 The Thompson Hwy. survey notes show a 3' stone arch culvert at or near the corner
- 1965 Kenneth Suydam set a concrete nail for the corner 43.56 South of the SE corner of Section 12 T8S R4E as determined from witnesses given in the notes of a survey of Horton Road
- 1973 I set a iron pipe on line between M-3 and M-4 T8S R4E by retracing the north line of the 1965 survey by Kenneth Suydam and recorded it in L 2, P 491
- 1980 Lenawee County Road Commission rebuilt the road and set a monument box

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


April 7, 1998 I found iron pipe in monument box. Set 5/8" X 3' re-rod 0.02 East of the found iron pipe so as to be on line between M-3 and M-4 T8S R4E. A C.M.P. is 4'± south of this location.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod in monument box with a Re-mon cap stamped G.E.R. 13040 and is accepted as the best available evidence of the position of the original corner.

- "X" cut on West end of CMP N 65° W 21.31
- dbl hd nail & Re-mon tag in EP N 85° W 158.36
- "X" cut on face of road sign post N 20° E 49.39
- Fd. dbl hd nail & disc in E.P. S 45° E 52.59

M-3 T8S R4E North 43.13 GLO = 43.56

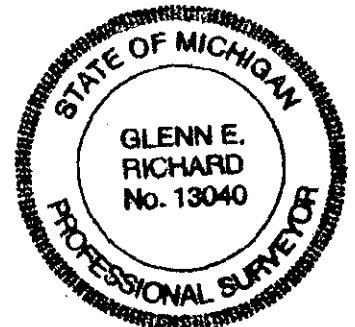

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date June 9, 1998

Signed by Glenn E. Richard Date 6-26-98
 Glenn E. Richard

Surveyor's Michigan License No. 13040