LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Luce
(County)

	Located In:	Corner Code #
1. Public Land Survey	T 45N R 8W	J7
	T____ R____	
	T____ R____	
	S____ T____ R____	
2. Property Controlling	S____ T____ R____	
in Section	S____ T____ R____	
3. Miscellaneous	S____ T____ R____	
Property in Sec.	S____ T____ R____	

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat_____

5. Private Claims

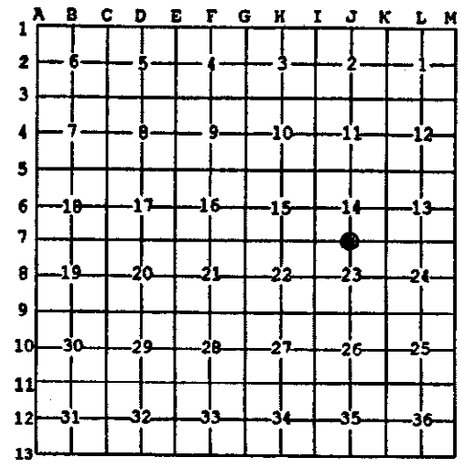

Jun 25 2003

I, Stephan J. Szyszkoski, in a field survey on _____, 20 ____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(J7) Quarter corner common to Sections 14-23. 1849: Established by William Ives: East random between Sectdions 14 & 23. 80.45 Intersected 19 Links South of post. West corrected S89 deg. 52'W ...40.22 Set quarter Section post. Sugar 8 S27W 21, Sugar 7 N58E 31. ...80.45 Corner of Sections. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J7) The original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between I7 and K7 as reestablished and remonumented by Billy D. Buckler in 1972. I found the mean true bearing and distance of this line to be N89 deg. 22'57"W 5322.11' (80.64 ch.)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J7) Set a 1"IDx36" I.pipe with 4" alum.
MDNR cap, appropriately stamped.
Blazed, scribed, and set meas. nails in:

6" Maple S70W 11.45'	"1/4S NBT"
5" Maple S30W 18.05'	do
6" Maple S64E 9.2'	do
7" Maple N33E 15.65'	do

Placed a cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.

STATE OF MICHIGAN
STEPHAN J. SZYSZKOSKI
LAND SURVEYOR
No. 33986
LICENSED LAND SURVEYOR

Signed by Stephan J. Szyszkoski Date 10/16/03

Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources, Office of Land and Facilities

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
Revised May 14, 1975
Revised Jan., 1983
Revised Oct., 1995