

SURVEY & REMONUMENTATION

LUCE COUNTY REMONUMENTATION CORNER

APR 28 1995

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **COMMISSION**
Luce

	Located In:	Corner Code #
1. Public Land Survey	T <u>45N</u> R <u>9W</u>	E-6
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Filed 1/20 A.D., 1995
 At 12:30 o'clock P. M.
 Liber 2
 File No. page 608
Kathy S. Mahan
 Luce County Reg. of Deeds
 Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on December 1, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

E-6 1/4 Corner Common to Sections 16 & 17, T45N, R9W

Original ties to post: Beech 6, S22°E 09 links
 Sugar 5, N17°W 22 links


Found no evidence of subsequent restoration of this corner.



B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-6 (T45N, R9W)

This corner is being re-established as part of the Luce County Remonumentation Program. Found the remains of a rotted corner fence post, with old fence lines running north, south, east, and west. Corner is 2633.86 feet from section corner to the north, 2702.43 feet from section corner to the south, and is 34.97 feet east of a straight line between said corners. Accepted position as best available evidence of corner location. Set a 1/2" iron and cap in center of remains of post.

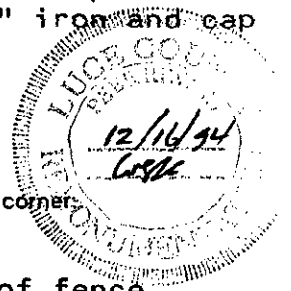

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-6 (T45N, R9W)

Corner is a 1/2" iron with plastic cap #33142 at the intersection of fence lines. Witnesses:

- 7" Sugar Maple, S46°W 24.40'
- 6" Sugar Maple, S12°W 28.39'
- 12" Sugar Maple, N08°E 35.15'
- New 6" Wood Post; EAST 1.95'

Note: Distances are to a nail and tag in side of the witness object. Trees are blazed and painted. Bearings are compass bearings corrected for declination.

Signed by Keith R. Waters Date 12-23-94
 Surveyor's Michigan License No. 33142