

SURVEY & REMONUMENTATION

APR 28 1995

LUCE COUNTY REMONUMENTATION CORNER

COMMISSION


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Luce

(County)	Located In:	Corner Code #
1. Public Land Survey	T 45N R 9W	E-7
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Filed 1/20 A.D., 19 95
At 12:30 o'clock P.M.
Liber 2
File No. page 617
Kathy S. Naha
Luce County Reg. of Deeds*

Register of Deeds Stamp & File Number

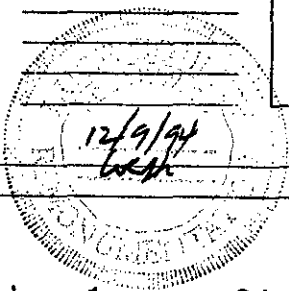

A	B	C	D	E	F	G	H	I	J	K	L	N
2	6	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Keith R. Waters, in a field survey on December 1, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-7 Corner Common to Sections 16, 17, 20, & 21, T45N, R9W

Original ties to post: Beech 12, S74°W 35 links
Yellow Birch, 7, S27°W 22 links

Found no evidence of subsequent restoration of this corner.



B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-7 (T45N, R9W)

This corner is being re-established as part of the Luce County Remonumentation Program. Re-established corner on the easterly extension of the line between established corners at NW corner and North 1/4 corners of Section 20. Distance from said 1/4 corner determined by pro-rating GLO distance between north 1/4 corners of Section 20 & 21. This makes the north 1/4 corner of Section 20 mid-way on line between Section corners east and west. Using this position for Section corner E-7 to establish 1/4 corner E-8 works very well with an east-west 1/4 line fence in Section 20, on the west side of County Road 399 and also other small parcels in the area. Position also fits well with a fence line on the north side of the NW 1/4 of the NE 1/4 of Section 20.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-7 (T45N, R9W)

Corner is a 1/2" iron with a plastic cap #33142 approximately 40 feet south of an east-west 2-track road. Witnesses:

- 5" Ironwood, S82°E 25.76'
- 8" Cherry, N71°W 31.01'
- 9" Cherry, S29°W 43.92'
- 6" Cherry, N44°E 41.22'

Note: Distances are to a nail and tag in the side of the tree. Trees are blazed and painted. Bearings are compass bearings corrected for declination.

Signed by Keith R. Waters

Date 12-23-94

Surveyor's Michigan License No. 33142