

1993

LUCE COUNTY REMONUMENTATION CORNER

COMMISSION

LAND CORNER RECORDATION CERTIFICATE


Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Luce

(County)	Located In:	Corner Code #
1. Public Land Survey	T <u>45N</u> R <u>10W</u>	D-7
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Filed 12-22 A.D., 19 93
 At 10:00 o'clock A.M.
 File No. 49 494
Keith R. Waters
 Luce County Reg. of Deeds
 Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on September, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

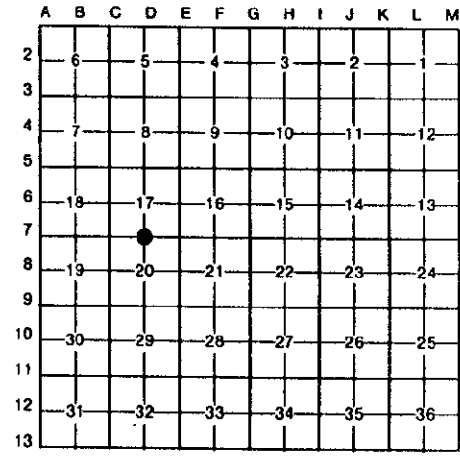


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
D-7 1/4 Corner Common to Sections 17 & 20, T45N, R10W

Original ties to post: 1978 - The north line of Section 20 is shown on a survey recorded by Thomas M. Kelly, R.L.S. 24599, in Book 1, Page 23, of Luce County recorded surveys, no location is shown for the corner.

Beech 18, S47°E 49 links
 Beech 12, N58°W 07 links

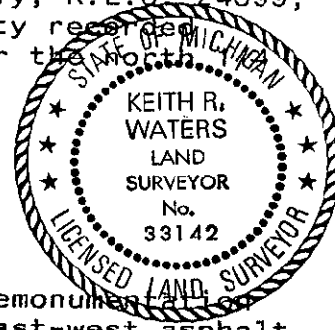

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
D-7

This corner is being perpetuated as part of the Luce County Remonumentation Program. Found a 1/2" iron pin 0.4' north of centerline of east-west asphalt road (County Road 458). Iron is equidistant between northwest and northeast corners of Section 20, 6.38' south of straight line between said corners. North-south position works with a found right-of-way iron on the south side of County Road 458, west of 1/4 corner. Accepted corner as found and set an aluminum Luce County cap on iron.
 (Note: The distance shown on the north line of Section 20 is shown as 5264.76' on Kelly survey. It appears that the distance should read 5246.76' based on my measurements and on other information shown on the survey.)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
D-7

Corner is a 1/2" rebar with 3/4" aluminum Luce County cap 0.4 feet north of centerline of County Road 458. Witnesses:

- 6" Beech, N13°W 57.99'
- 7" Sugar Maple, S40°E 48.76'
- 6" Ironwood, S08°W 31.03'
- 4" Ironwood, S47°W 42.63'

Note: Distances are to a nail and tag in the side of tree. Trees are blazed and painted. Bearings are compass bearings corrected for declination.

Signed by Keith R. Waters Date 12-20-93
 Surveyor's Michigan License No. 33142