

Survey & REVISION

LUCE COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

APR 01 1996

For corners in

LUCE COUNTY
REGISTER OF DEEDS
Recorded

Liber 2 Page 664
02-29-1996 15:11:10
Kathy S. Mahar
Kathy S. Mahar, Register
REGISTER OF DEEDS

COMMISSION

Luce Located In: Corner Code #
(County)

1. Public Land Survey T45N R11W C-9
T___ R___
T___ R___
T___ R___

2. Property Controlling S___ T___ R___
in Section S___ T___ R___

3. Miscellaneous S___ T___ R___
Property in Sec. S___ T___ R___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, William L. Karr, in a field survey on Dec. 14, 1995 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(C-9) Corner of Sections 19, 20, 29 and 30, T45N, R11W

- 1849: Wm. Ives set post
7" Beech N40°W 36 links 8" Sugar S50°E 20 links
- MDOT: Old R.O.W Maps show corner as being 2657.30 West of 1/4 corner. Also show angle off tan. of survey centerline.
- 1978: Thomas A. Beaudrie, L.S. 11359 in Liber 1, Page 19 of recorded surveys, shows corner but does not indicate what it was.
- 1989: Wm. F. Bowman, L.S. 28406 in Liber B, Page 316 of recorded corners found 1/2" iron from Beaudrie Survey and accepted it.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C-9) This corner is being perpetuated as part of the Luce County Remonumentation program.

Found corner as recorded by Bowman in 1989 and accepted position as found.

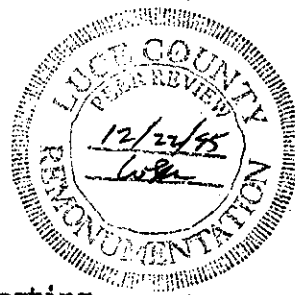

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C-9) Corner is a 1/2"x 18" iron no cap in monument box and falls in intersecting centerlines.

Witnesses:	Power Pole (NY3/167/27)	S53°W	67.4'
	Western Most Anchor Bolt in Sign Base	S65°E	66.5'
	South Sign Post	N46°E	68.32'
	20" Maple	N25°W	88.97'



Signed by William L. Karr
Surveyor's Michigan License No. 27450

Date 12/26/95