

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

Three Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 45 N. R. 12 W.	I-2, K-3, 3-3-c.2
2. PROPERTY CONTROLLING IN SECTION	2, T. 45 N. R. 12 W.	
3. MISCELLANEOUS PROPERTY IN SECTION	, T. N. S. R. E. W.	
4. LOT NO.	RECORDED PLAT	
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 6-11 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on 19, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:**
 Corners set originally by Guy H. Carleton, D.S. in 1849.
- I-2 Cor. bet. Secs. 2-3: Bearings were: Cedar 10", N39°W, 21 lks.
Cedar 8", S74°E, 8 lks.
 - K-3 Sec. Cor. common to Secs. 1-2-11-12.
bearings were: Beach 10", N35°W, 28 lks. and Sugar 12", S64°E, 13 lks.
 - 3-Sec.2 North 1/4 Corner, bet. Secs. 2 and 3.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**
- I-2 Found remnant of Cedar E.P., N39°W, 21 lks, down with both faces complete with scribe marks. Found old blazed lines about 60 years old North and East of corner.
 - K-3 Replaced corner in center of E-W road and in line with an old fence line to North. Distances checks to corners both East and West.
 - 3-Sec.2 Placed corner at corner of an old fence, which runs North and West. Proportionate distance bet. Corners to North and South is very good.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**
 Placed 1" pipe with 4" aluminium cap at all corners.
- I-2 New Bearings: 11" Cedar, East, 14.7' and 10" Cedar, N27°W, 13.6'
 - K-3 New Bearings: 14" Elm, N2°W, 30.2' and 8" Maple, S16°W, 16.4'
 - 3-Sec.2 New Bearings: 10" H. Maple, N34°E, 24.0' and 7" H. Maple, S61°E, 32.8'


SIGNED BY Billy D. Buckler DATE 9-26-73

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

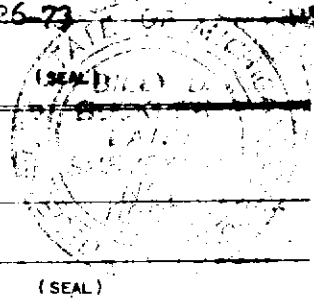

SURVEYOR'S MICHIGAN REGISTRATION NO. _____