

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

Two Corners

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>45</u> N. X , R. <u>12</u> W.	<u>G-2, G-4</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 12/5, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corners set by Guy H. Carleton, D.S. in 1849.

- G-2** Quarter Corner bet. Sec's. 3 and 4. Bearings were: Cedar 6", N2°W, 13 lks. and Cedar 10", S28°E, 11 lks.
- G-4** Quarter Corner bet. Sec's. 9 and 10. Bearings were: Spruce 6", S85°W, 21 lks. and Cedar 12", S40°E, 16 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-2** Replaced corner from Cedar witness, S28°E, 11 lks.; stump with notch and remains of lower face. Found Cedar Stump bottom at position of the second witness.
- G-4** Replaced corner from the original Cedar witness; a stump 3½' high, now 16" diameter, found lower part of top face and all of bottom face, notch and calloused overgrowth with scribe marks.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at both corners.

- | | |
|---|--|
| G-2 New Bearings:
6" Cedar, S28°E, 30.0'
5" Balsam, S70°W, 8.0'
4" Spruce, N71°E, 10.4' | G-4 New Bearings:
9" Cedar, S64°W, 18.2'
8" Cedar, N06°W, 12.9' |
|---|--|

SIGNED BY Billy D. Buckler DATE 10-78
 Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

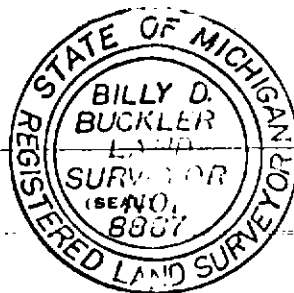

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____