

**SURVEY &
REMONUMENTATION**

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Luce County Remonumentation Corner**

MAR 13 2000

For corners in


Luce County	Located in:	Corner Code #
1. Public Land Survey	T45N R12W	L-11
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. , Recorded Plat		
5. Private Claims		

SECTION

LUCE COUNTY
REGISTER OF DEEDS
Recorded
Liber 3 Page 876
02-08-2000 08:27:03
Kathy S. Mahar
Kathy S. Mahar, Register
REGISTER OF DEEDS
Register of Deeds Stamp & File Number

I, William L. Karr, in a field survey on December 1, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

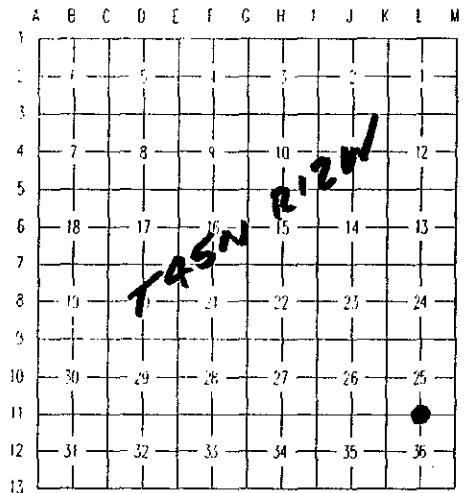


A. Description of original monument and accessories and/or subsequent restoration:
(L-11) 1/4 Corner between Sections 25 and 36, Township 45 North, Range 12 West.

1849 G.H. Carleton set post for corner in original survey. Witnesses: Cedar 12" N77°E 21 lks
Cedar 12" S43°W 12 lks.

Found no subsequent survey history on this corner in available public records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
(L-11) 1/4 Corner between Sections 25 and 36, Township 45 North, Range 12 West.
This corner is being perpetuated as part of the Luce County Remonumentation Program.

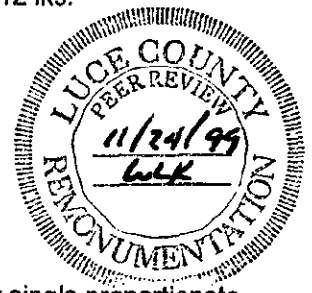

Found no evidence of the original corner or subsequent restoration. Re-established corner by single proportionate measurement between Section Corner 1/2 mile West and the meander corner to the East. Distance West is 2641.94 feet (GLO 2640.0 feet). Distance East is 1996.65 feet (GLO 1995.18 feet).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
(L-11) 1/4 Corner between Sections 25 and 36, Township 45 North, Range 12 West.

Corner is a 1/2" x 48" re-rod with a stamped aluminum Luce County Remonumentation cap.

Witnesses:

Cedar 6"	S77°E	14.62 feet
Cedar 5"	S10°E	6.89 feet
Cedar 8"	S57°W	19.57 feet
Cedar 8"	N69°W	4.99 feet



Bearings are compass bearings, corrected for declination (6° W), all distances are to a nail and tag in the side of the witness object unless otherwise noted.

Signed by *William L. Karr*

Date 12-29-99

Surveyor's Michigan License No. 27450