

**SURVEY & REMONUMENTATION**

MAY 28 1997

COMMISSION

**LUCE COUNTY REMONUMENTATION CORNER**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Luce _____ (County)	Located In:	Corner Code #
1. Public Land Survey	T46N R 9W	<input checked="" type="checkbox"/> A-3 Same
	T46N R 10W	<input type="checkbox"/> M-3 Corner
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

LUCE COUNTY REGISTER OF DEEDS

Recorded  
*Liber 2 Page 717*  
03-28-1997 08:55:45  
*Kathy S. Mahar*  
Kathy S. Mahar, Register  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

I, Keith R. Waters, in a field survey on 03/18, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

**A. Description of original monument and accessories and/or subsequent restoration:**

A-3 (M-3) Corner Common to Sections 6 & 7, T46N, R9W & Sections 1 & 12, T46N, R10W  
1841 - Original ties to set post (John Burt): Hemlock 22, S50°W 49 links - Hemlock 13, N31°E 31 links.  
1974 - Billy D. Buckler, RLS 8887, page 142 of Luce County recorded corners. Corner re-established by single proportionate measurement on township line between corners 1 mile north and 1 1/2 miles south.  
Placed a 1" pipe with aluminum cap at corner. Witnesses: 8" White Birch, S85°W 16.4' - 8" Black Spruce, N42°E 28.3'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

This corner is being perpetuated as part of the Luce County Remonumentation Program.  
Found a 1" pipe with a stamped aluminum DNR cap and Buckler's spruce bearing tree. (It appears that the bearings to Buckler's witnesses are reversed, the spruce bears S85°W from the found corner. The corner position was verified by measurements to other recovered corners on the range line). Accepted corner as found and established additional bearing trees.

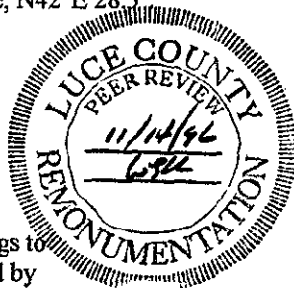

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Corner is a 1" iron pipe with a stamped aluminum DNR cap.  
Witnesses:  
8" Spruce, S85°W 28.68' (existing bearing tree)  
8" White Birch, N29°W 3.19'  
10" Cedar, N08°E 20.95'  
8" Cedar, N57°W 20.03'

Note: Distances are to a nail/tag P.S. 33142 in the side of the witness object. Trees are blazed and painted. Bearings are compass bearings corrected for declination.



Signed by Keith R. Waters  
Surveyor's Michigan License No. 33142

Date 12-30-96