

LUCE COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Luce _____ (County)	Located In:	Corner Code #
1. Public Land Survey	T46N R 9W	G-9
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

LUCE COUNTY  
REGISTER OF DEEDS  
Recorded

Liber 2 Page 660  
02-29-1996 15:22:49

*Kathy S. Mahaf*  
Kathy S. Mahaf, Register  
REGISTER OF DEEDS Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Keith R. Waters, in a field survey on 12/18, 1995 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

G-9 Corner Common to Sections 21, 22, 27, & 28, Town 46 North, Range 9 West  
1850 - Original ties to set post: Maple 10, N44°W 31 links - Cedar 10, S75°E 34 links.

1959 - Harold R. Bruning, R.L.S. 10681, Michigan Society of Registered Land Surveyors, Upper Peninsula Chapter, Land Corner Record, Luce County Recorded Corners. Placed a 4" x 1 1/4" iron pipe with a 3" brass cap from live standing original maple bearing tree and stump from original cedar bearing tree. Witnesses: 13" Hard Maple, S79°W 44 links (29.04') - 5" White Spruce, N32°W 60 links (39.60') - 13" White Pine, N65°E 48 links (31.68') - 4" Cedar, S62°E 28 links (18.48')


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Luce County Remonumentation Program.  
Found a 1 1/4" iron pipe with a 3" stamped brass cap along with the white pine and spruce bearing trees as called for in 1959 corner record by Harold Bruning. Accepted corner as found and established additional bearing trees.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 1 1/4" iron pipe with a stamped 3" brass cap.  
Witnesses:  
26" White Pine, N68°E 31.67'  
8" Spruce, N38°W 39.03'  
9" Hemlock, SOUTH 12.80'  
16" Hemlock, N30°E 15.70'

Note: Distances are to a nail/tag P.S. 33142 in the side of the tree. Trees are blazed and painted.  
Bearings are compass bearings corrected for declination.

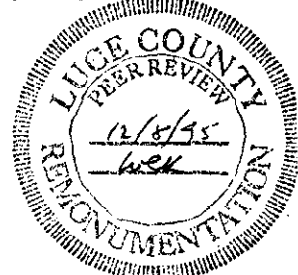

Signed by Keith R. Waters  
Surveyor's Michigan License No. 33142

Date 12-29-95