

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
 Luce Co. Three Corners

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 46 ^{N.} _{S.} , R. 10 ^{E.} _{W.}	F-5 C-5 B-3
2. PROPERTY CONTROLLING IN SECTION	T. _____, S. _____, R. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____, S. _____, R. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 6/7 & 7/10 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Geo. H. Cannon D.S. in 1853

F-5	¼ Cor. bet. Sec's. 9-16. Bearings were:	Cedar 14,	N68°W,	29 lks.
		Cedar 12,	S66°E,	30 lks.
C-5	Sec. Cor. 7-8-17-18. Bearings were:	Beech 12,	N18°E,	45 lks.
		Beech 12,	S55°W,	15 lks.
B-3	¼ Cor. bet. Sec's. 6-7. Bearings were:	Beech 12,	N35°W,	12 lks.
		Birch 9,	S64°E,	21 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

F-5 Replaced from possible B.T., a Cedar, stream crossing checks.

C-5 Re-established from corners East, West, and North.

B-3 Re-established by single proportionate measure bet. two Section Corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

All corners 1" x 36" pipe with Dep't cap.


F-5 New bearings: 10" Cedar, N32°W, 5.8' and 14" Cedar, S57°E, 22.2'

C-5 New bearings: 14" W. Pine, S15°E, 86.0' and 10" Apple, N60°W, 60.6'

B-3 New bearings: 12" W. Pine, N67°E, 8.9' and 14" Spruce, West, 6.5'

SIGNED BY Billy D. Buckler DATE 7/30/74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

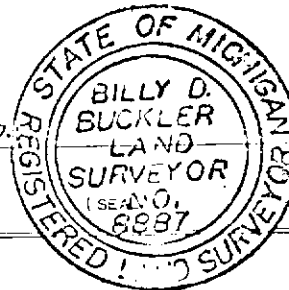

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____