

MAY 28 1997

COMMISSION

**LUCE COUNTY REMONUMENTATION CORNER**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Luce \_\_\_\_\_  
(County)


Located In:

Corner Code #

1. Public Land Survey

T46N R 9W

T46N R 10W



2. Property Controlling in Section

S \_\_\_\_\_

T \_\_\_\_\_

\_\_\_\_\_

3. Miscellaneous Property in Sec.

S \_\_\_\_\_

T \_\_\_\_\_

\_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

LUCE COUNTY  
REGISTER OF DEEDS  
Recorded

*Liber 2 Page 719*

07-28-1997 08:56:02

*Kathy S. Mahar*  
Kathy S. Mahar, Register  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on 09/16, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

A-5 (M-5) Corner Common to Sections 7 & 18, T46N, R9W & Sections 12 & 13, T46N, R10W

1841 - Original corner (John Burt) was a 10" Spruce. Witness: Spruce 10, N63°E.


1974 - Billy D. Buckler, RLS 8887, page 142 of Luce County recorded corners. Corner re-established by single proportionate measurement on township line between corners ½ mile south and 2 miles north.

Placed a 1" pipe with aluminum cap at corner. Witnesses: 8" Cedar, N11°W 46.0' - 8" White Birch, S22°W 20.4'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Luce County Remonumentation Program.

Found a 1" pipe with a stamped aluminum DNR cap and both of Buckler's bearing trees. Accepted corner as found and established additional bearing trees.

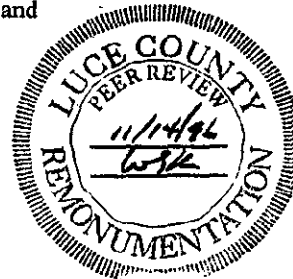

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 1" iron pipe with a stamped aluminum DNR cap.

Witnesses:

9" Cedar, N11°W 46.46' (existing bearing tree)

9" White Birch, S22°W 20.56' (existing bearing tree)

10" Balsam Fir, S34°E 9.46'

13" Spruce, S79°W 52.10'

Note: Distances are to a nail/tag P.S. 33142 in the side of the witness object. Trees are blazed and painted.

Bearings are compass bearings corrected for declination.



Signed by Keith R. Waters  
Surveyor's Michigan License No. 33142

Date 12-30-96