

**SURVEY & REMONUMENTATION**

MAY 28 1997

COMMISSION

LUCE COUNTY REMONUMENTATION CORNER

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Luce</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T45N R 12W T46N R 12W	L-1 Same L-13 corner
2. Property Controlling in Section	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____

LUCE COUNTY REGISTER OF DEEDS  
Recorded

*Liber 2 Page 742*

02-28-1997 08:59:58

*Kathy S. Mahar*  
Kathy S. Mahar, Register  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_


I, William L. Karr, in a field survey on Dec. 12, 19 96 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L
1											
2	6		5		4		3		2		1
3											
4	7		8		9		10		11		12
5											
6	18		17		16		15		14		13
7											
8	19		20		21		22		23		24
9											
10	30		29		28		27		26		25
11											
12	31		32		33		34		35		36
13											

A. Description of original monument and accessories and/or subsequent restoration:

(L-1) 1/4 Corner Common to Section 1, T.45 N., R.12 W. & Section 36, T.46 N., R.12 W. 1841: J. Burt for W.A. Burt set 1/4 Section post Hemlock 30 N55°E 12

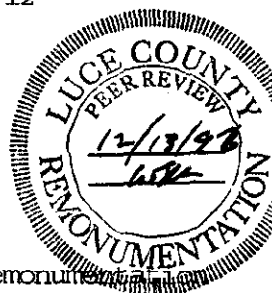

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(L-1) This Corner is being perpetuated as part of the Luce County Remonumentation Program.

Found no evidence of original corner. Found a 1" pipe, 3" above ground on the North side of an old trail. There is the remains of an old fenceline to the East. Corner falls 26.2' North of a straight line between Section corners. Distance to the West is 2638.05'. Distance to the East is 2641.61'. Accepted corner position as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(L-1) Corner is a 1" pipe, 3" above ground on the North side of an old trail.

Witnesses:	B. Spruce 12"	N83°E	15.24'
	B. Spruce 6"	S17°E	5.81'
	B. Spruce 7"	S28°W	34.76'
	W. Spruce 7"	N55°W	12.49'



Signed by *William L. Karr* Date 12-30-96  
Surveyor's Michigan License No. 27450

NOTE: All bearings are compass bearings corrected for declination. All distances are to a nail in side of witness objects unless noted.