

MAY 28 1997

COMMISSION

**LUCE COUNTY REMONUMENTATION CORNER**

**LAND CORNER RECORDATION CERTIFICATE**  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Luce _____ (County)	Located in:	Corner Code #
1. Public Land Survey	T46N R 10W	L-1 Same
	T47N R 10W	L-13 Corner
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

LUCE COUNTY  
 REGISTER OF DEEDS  
 Recorded  
*Liber 2 Page 714*  
 02-28-1997 08:55:04  
*Kathy S. Mahar*  
 Kathy S. Mahar, Register  
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Keith R. Waters, in a field survey on 12/10, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A	B	C	D	E	F	G	H	I	J	K	L
1											
2	6		5		4		3		2		1
3											
4	7		8		9		10		11		12
5											
6	18		17		16		15		14		13
7											
8	19		20		21		22		23		24
9											
10	30		29		28		27		26		25
11											
12	31		32		33		34		35		36
13											

A. Description of original monument and accessories and/or subsequent restoration:

L-1 (L-13) 1/4 Corner Common to Section 1, T46N, R10W & Section 36, T47N, R10W  
 1841 - Original ties to set post (John Burt): Beech 6, NE 22 links - Hemlock 15, NW 18 links.  
 Department of Natural Resources sketch of Section 36 shows corner midway on line between section corners 5287.8 feet apart.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being re-established as part of the Luce County Remonumentation Program.  
 Found no evidence of corner. Re-established corner by single proportionate measurement on line between section corners east and west. The distance between said section corners checks very well with above mentioned DNR notes.

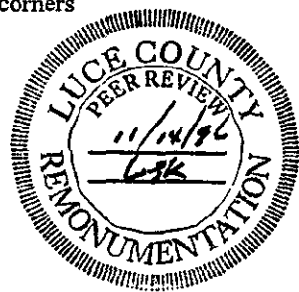

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 1/2" iron with a stamped aluminum Luce County Remonumentation cap on the west side of a square wooden fence post at the east end of east-west fence line. Witnesses:  
 7" Sugar Maple, N45°E 5.49'  
 6" Sugar Maple, N82°W 2.12'  
 5" Red Maple, N04°E 21.15'  
 5" Sugar Maple, S64°W 8.52'

Note: Distances are to a nail/tag #33142 in the side of the tree.  
 Bearings are compass bearings corrected for declination.



Signed by Keith R. Waters  
 Surveyor's Michigan License No. 33142

Date 12-30-96