

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Luce Co. 4 Corners.

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>49</u> N. <input checked="" type="checkbox"/> , R. <u>8</u> W. <input checked="" type="checkbox"/>	B-7 <u>12-Sec. 18</u>
2. PROPERTY CONTROLLING IN SECTION <u>18</u>	, T. <u>49</u> N. <input checked="" type="checkbox"/> , R. <u>8</u> W. <input checked="" type="checkbox"/>	<u>13-Sec. 18</u> <u>16-Sec. 18</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____, R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6/6, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- B-7 Witness Corner to Quarter Corner between Sections 18-19.
- 12-Sec. 18 South 1/16 Corner, Section 18.
- 13-Sec. 18 Southeast 1/16 Corner, Section 18.
- 16-Sec. 18 East 1/16 Corner, between Section's 18-19.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- B-7 Re-established corner on line and by single prop. measure between two Sec. Cors. Found no evidence of original corner. Corner position lines in a stream.
- 12-Sec. 18 Placed corner midway bet. Center of Section and the South $\frac{1}{4}$ corner.
- 13-Sec. 18 Placed corner at intersection of lines quartering the Southeast quarter section.
- 16-Sec. 18 Placed corner midway and on line bet. $\frac{1}{4}$ Cor. to West and Sec. Cor. to East.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners.

- B-7 Bearings for Witness Corner: 28" W. Pine, S2^oW, 70.1' and 26" W. Pine, S70^oW, 60.0'. Corner is 10 feet South of Corner location; as a witness corner.
- 12-Sec. 18 Bearings: 10" Twin W. Pine, S33^oW, 3.2' and 12" W. Pine, N72^oE, 38.4'.
- 13-Sec. 18 Bearings: 8" W. Pine, N69^oW, 20.3' and 10" W. Pine, N67^oE, 25.4'.
- 16-Sec. 18 Bearings: 8" R. Pine, N20^oE, 15.2' and 12" W. Pine, S36^oW, 34.0'.

SIGNED BY Billy D. Buckler DATE 9-8-78
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

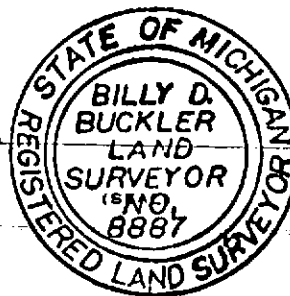

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____