

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

<u>Luce</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S <u>11</u> T <u>49N</u> R <u>09W</u>	<u>J 4</u>
	S <u>11</u> T <u>49N</u> R <u>09W</u>	<u>7</u>
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims		

Register of Deeds Stamp & File
Number

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Stephan J. Szyszkoski, in a field survey on Sept 25, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:
 (J4) Center of Section 11. Not established in the original survey.

(7-Sec. 11) North 1/16 corner between Sections 11 and 12. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (J4) Established the corner at the intersection of straight lines connecting opposite quarter corners.

(7-Sec. 11) Established the corner midway and on the Section line between Section corner 1321.36' north and Quarter corner 1321.36' south. The position for the corner falls on the westerly edge of a trail.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (J4) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. (7) Set 1"IDx36" I.pipe with plastic cap stamped "MICH DNR LS33986", buried. Set measuring nail with MDNR tag in the side of:
 12" R.Pine S25E 23.0' mrkd "CS BT" with MDNR tag in the side of the following:
 7" Maple clump N22E 21.06' do 4" J.Pine S34W 6.7' mrkd "N1/16 BT"
 13" J.Pine N79W 27.97' do 11" R.Pine N81W 22.8' do
 11" J.Pine S63W 24.62' do 10" J.Pine N56E 18.45' do
 Bearings are magnetic. 11" J.Pine S66E 33.47' do
 Bearings are magnetic.

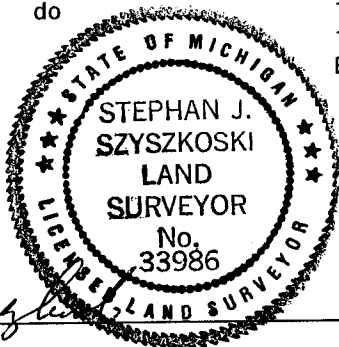

Signed by Stephan J. Szyszkoski Date 10/25/07

Surveyor's Michigan License No. 33986