

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Luce <small>(County)</small>	Located In:	Corner Code #	
1. Public Land Survey	T 49N R 10W	G3	_____
	T 49N R 10W	K2	_____
	T _____ R _____		_____
2. Property Controlling in Section	S _____ T _____ R _____		_____
	S _____ T _____ R _____		_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____		_____
	S _____ T _____ R _____		_____

Register of Deeds Stamp & File
Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 09 2004

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


- (G3) Corner common to Sections 3-4-9-10. 1957 - Remonumented by Billy D. Buckler, RLS, from a Yellow Pine 8T bearing S15W 73 links. Set 1/2"x36" iron bar driven 6" below surface of fire lane intersection. 6" Jack Pine N45W 80 links, 6" Jack Pine S58W 38 links, 7" Jack Pine S51E 72 links.
- (K2) Quarter corner common to Sections 1-2. 1957 - Remonumented by Billy D. Buckler, RLS: This corner replaced as set by H. Lawrence, R.L.S. Found a scribed wood post and remains of one J. Pine stump in proper position for a recorded witness. Corner lies 20' SE of a trail and on east edge of an old jack pine cutting. Set 1" pipe with 4" aluminum cap. 10" J.Pine N58E 36.1', 6" J.Pine N10W 19.4'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (G3) Found 1/2" dia. iron bar 6" below ground surface at record bearing and distance from the 1957 NBTs NW and SW, now dead and down. The NBT SE was not recovered. The Yellow Pine 8T SW was not recovered. Accepted the iron bar and made new witnesses as described below. The corner falls in the intersection of fire lanes N-S-E-W.
- (K2) Recovered the 1957 monument, a 1" ID iron pipe with 4" brass Michigan Dept. of Conservation tablet, at record bearing and distance from the 1957 NBTs. The J. Pine NBT NW has scribing visible. The J. Pine NBT NE is a stump. Also recovered the stump remains of the J.Pine 8BT noted in the 1957 record S59W 44 links. The corner falls about 21' SE of a trail road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|------------------------------------------------------------------------|------------------------------------------------------------------------------------------------|
| (G3) Found 1/2" dia. iron bar 6" below ground. Set measuring nails in: | (K2) Found 1" ID I. pipe with 4" brass cap. Set measuring nails in: |
| 12" J.Pine S43E 24.9' mrkd "S10 NBT" | 8" J.Pine N04W 19.8' old marks * |
| 9" R.Pine S45W 49.65' "S9 NBT" | 10" J.Pine S55W 7.65' mrkd "1/4S NBT" |
| 7" J.Pine N52W 20.1' "S4 NBT" | 5" J.Pine N64E 6.7' mrkd "1/4S NBT" |
| 8" J.Pine N35E 37.25' "S3 NBT" | 7" J.Pine S13E 12.8' do |
| Bearings are magnetic. Distances are to nail with tag. | Metal post adjacent. Bearings are magnetic. Distances are to nail with tag. * denotes 1957 NBT |

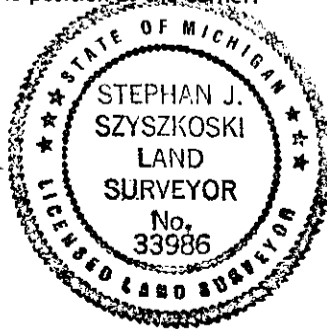

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 12/20/04

For the Michigan Department of Natural Resources, Office of Land and Facilities