

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Luce Co.

4 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>50</u> N. <u>8</u> R. <u>8</u> W.	I-5, H-5
2. PROPERTY CONTROL- 15 ING IN SECTION _____	T. <u>50</u> N. <u>8</u> R. <u>8</u> W.	6-Sec.15, 2-Sec.15
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ R. _____ E. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 2-5, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

I-5 & H-5 set by Wells Burt, D.S. in 1850. Bearings were:

- I-5 Sec. Cor. common to Sec's. 10-11-14-15: Y. Birch 8", S29°W, 27 lks & Y. Birch 10", N12°E, 15 lks.
- H-5 1/4 Corner bet. Sec's. 10-15: W. Birch 10", N72°E, 5 lks & Spruce 6", S50°W, 18 lks.
- 6-Sec.15 North-East 1/16 corner of section 15.
- 2-Sec.15 East 1/16 Corner on North side of section 15.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- I-5 Restored sec. cor. by extending a strait line from sec. cor. 9-10-15-16, easterly thru an original W. Pine line tree. Proportionate distance gives the mile 5,304.76' compared to record = 5,307.72'. Found wood post by J.H. Cook, 1952, 14.6' East and 3.7' North of corner.
- H-5 Re-established corner by pro. measure and on line bet. sec. cor. to West and a line tree to East.
- 6-Sec.15 Placed corner at computed intersection of lines quartering the quarter section.
- 2-Sec.15 Placed corner midway bet. 1/4 cor. West and sec. cor. to East.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Placed 1" pipe with 4" aluminum cap at all 4 corners. Bearings:

- I-5 7" W. Pine, S62°W, 3.2' & 7" Spruce, N77°E, 5.0' & 8" Spruce S52°E, 10.4'.
- H-5 10" S. Maple, N8°W, 39.2' & 6" S. Maple, S63°E, 36.4' & 6" W. Birch, S23°E, 18.3'.
- 6-Sec.15 12" R. Maple, N17°E, 11.9' & 24" Spruce, N5°W, 28.2' & 7" R. Maple, S11°W, 6.6'.
- 2-Sec.15 12" Spruce, N48°W, 7.2' & 10" Spruce, S72°E, 18.1' & 16" W. Pine, N17°E, 26.5'.

SIGNED BY \_\_\_\_\_ DATE 10-9-80

Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

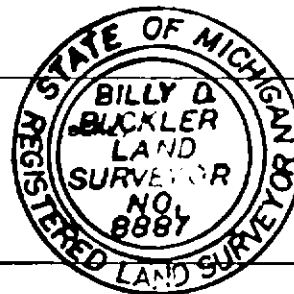

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971  
REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET