

41

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Luce

(County)

Located in:

Corner Code #

1. Public Land Survey

T ___ R ___
T ___ R ___
T ___ R ___
T ___ R ___

2. Property Controlling
in Section

S 32 T 50N R 8W 16

3. Miscellaneous
Property in Sec.

S ___ T ___ R ___
S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Aug 05 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19__ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													


A. Description of original monument and accessories and/or subsequent restoration:
(16-Sec. 32) East 1/16 corner between Sec. 32 T50N-R8W and Sec. 5 T49N-R8W. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(16-Sec. 32) Found no monumentation at the corner position. Established the corner midway and on a straight line between 1/4 corner 1329.00' west and section corner 1329.00' east. At the position for the corner, I placed a 1" I.D. x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet appropriately stamped. Corner placed and witnessed by T.Stark, Newberry District Office. The corner falls at the east edge of a logging trail.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(16) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails
in the following:
4" Maple North 8.1' "E1/16 BT"
10" Maple S13W 53.2' "E1/16 BT"
14" Maple S30W 30.2' "E1/16 BT"
10" Maple S70W 42.75' "E1/16 BT"
Placed a 3" squared and scribed cedar
post adjacent. Bearings are magnetic.

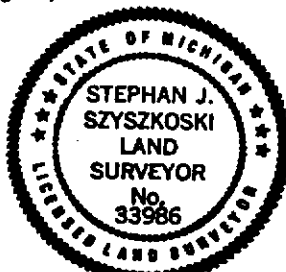

Signed by

Stephan J. Szyszkoski

Date

8/7/97

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division