

FILED

9

Oct 16 11 44 AM '95

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

NANCY HAVILAND  
REGISTER OF DEEDS  
LIVINGSTON COUNTY, MI  
48843

or corners in

LIVINGSTON  
(County)

Located In:	Corner Code $\neq$
Public Land Survey	T 1N R 4E H-9
	T R
	T R
	T R
Property Controlling	S T R
In Section	S T R
Miscellaneous	S T R
Property in Sec.	S T R

L. S. C. #498m

Register of Deeds Stamp & File Number

Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
Private Claims \_\_\_\_\_

DARRELL HUGHES, in a field survey on Oct. 4 ~~JANUARY 23~~, 19 95,  
I hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned  
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the  
current manual of survey instructions of the United States Department of the Interior, Bureau of Land  
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5  
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a  
Court of Law; established, re-established, monumented, re-monumented, recovered, found as  
expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

PUTNAM TWP.

SURVEY &  
REMONUMENTATION

NOV 27 1995

COMMISSION

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration:

GLO: 1823 Joseph Wampler, Deputy Surveyor  
White Oak 14" North 5-1/2 degrees East 93 links  
White Oak 10" South 26-1/2 degrees West 89 links


Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" iron pipe

\*Additional descriptions and historical information on back of this sheet.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H-9, T1N, R4E, PUTNAM, replaced existing corner with 1-1/4" X 36" iron pipe, affixed with 2" dia. brass cap, stamped "Livingston Co. Monumentation Corner, P.S. 19834, and is accepted as a careful and faithful reestablishment of the position of the original corner.  
035 DEG. 38.55' SET NAIL/TAG SE/S 10" HICKORY.  
334 DEG. 42.08' SET NAIL/TAG E/S 18" OAK.  
059 DEG. 47.44' SET NAIL/TAG NW/S 20" TWIN OAK.  
189 DEG. 42.88' SET NAIL/TAG W/S 14" ASH.  
191 DEG. 33.08' FD. 3/4" IRON PIPE.

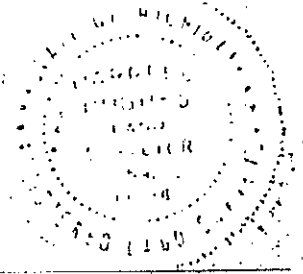

Signed by Darrell Hughes Date October 5, 1995

Surveyor's Michigan License No. 19834

PA. 345 1980, APPROVED BY LIVINGSTON COUNTY  
DEED GROUP ON 9-6-95 CO. REP JED

H-9, SOUTH 1/4 COR. SEC. 22 AND NORTH 1/4 COR. SEC. 27

FIELD: JANUARY 1995

FOUND 1/2" IRON PIPE 2.3' SOUTH OF CENTERLINE MOWER ROAD, 0.1' BELOW GRADE, 140'+/- WEST OF CENTERLINE FAIRWOOD DRIVE TO NORTH. WITNESS' AGREE WITH B. THOMPSON AND G. BOSS. 33.08' TO 3/4" FIP TO SOUTH. P.17-17A

- 1823 Corner first set by Joseph Wampler, U.S. Deputy Surveyor.... "40.28 chains, set 1/4 post" P.7
- 1838 John Farnsworth, county surveyor, uses corner in survey. P.8
- 1870-1913 Section corner witness' of county surveyors. P.9-9B
- 1913 Grant Dunning road construction notes calls for "dragtooth" for this corner.
- 1956 Lyle Munsell shows corner (railroad spike) witness'. P.11
- 1971 Charles Wilson finds 1/2" iron pipe, files Act 74. P.12
- 1980 Gary Boss plats "Fairwood" sub. to north. P.12A-12B.
- 1986 Gary Boss survey shows witness'. P.13-13A
- 1990 Brad Thompson surveys in NE1/4 sec.27, shows witness' and files Act 74. P.14-14A
- 1990 Don Ross surveys in Sec. 27, shows Wilson's 1971 witness'. P.15-15B
- 1995 Hughes witness comparisons. P.16, 17-17A.