

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY <u>7</u> T. <u>1</u> N. <u>5</u> E. R. <u>5</u> E.		C-3, B-3, B-5
2. PROPERTY CONTROLLING IN SECTION _____, T. _____, N. _____, S. _____, R. _____, E. _____, W. _____		
3. MISCELLANEOUS PROPERTY IN SECTION _____, T. _____, N. _____, S. _____, R. _____, E. _____, W. _____		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

11-8-83  
Livingston Co

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Donald L. Bissell, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on January, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:


- A. Description of original monument and accessories and/or subsequent restoration:
- |   |  |
|---|--|
| C-3 W. Oak 18", S73° E, 55 lks.<br>W. Oak 12", S79½° W, 68 lks. | B-3 B. Oak 15", S52° W, 77 lks.<br>B. Oak 12", N76° W, 81 lks. |
| B-5 W. Oak 14", N 9° W, 20 lks.<br>B. Oak 18", S40° W, 33 lks.  |  |

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- |                                      |   |
|--------------------------------------|---|
| C-3 Found 1/2" pipe at fence corner. | B-3 Found 15" round stone also 10" & 12" W. Oaks at locations of old witnesses.<br>Set 4" Conc. mon. w/alum. cap in place of stone. |
| B-5 Found iron pin.                  |   |

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- |   |  |
|---|--|
| C-3 1/2" pipe at fence corner.<br>S75° E, 6.13', 10" W. Oak, pk & tag.<br>S45° W, 22.65', 5" R. Oak, Pk. & tag.<br>N82° W, 32.65', 12" B. Cherry, Pk. & tag.<br>N36° W, 28.53', 6" W. Oak, Pk. & tag. | B-3 4" Conc. mon. w/alum. cap.<br>N69° E - 16.15' - 6" B. oak, Pk. & tag<br>S10° W - 11.56' - 12" B. Oak, Pk & tag<br>S74° W - 51.18' - 14" Hickory, Pk. & tag<br>N35° W - 5.66' - Triple 5", 8" & 10" Hickory, Pk. & tag. |
| B-5 Iron pin<br>N65° E - 38.10' - 4" Maple, Pk. & tag.<br>S42° E - 34.98' - 6" Hickory, Pk. & tag.  | S41° W - 42.77' - 8" Ash, Pk. & Tag.<br>N20° W - 58.68' - Triple 10, 10 & 12" Ash, Pk. & tag.  |

SIGNED BY \_\_\_\_\_ SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FOR STATE AND UNITED STATES AGENCIES:  
SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
APPROVED AND SIGNED BY Donald L. Bissell DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
MICHIGAN REGISTERED LAND SURVEYOR

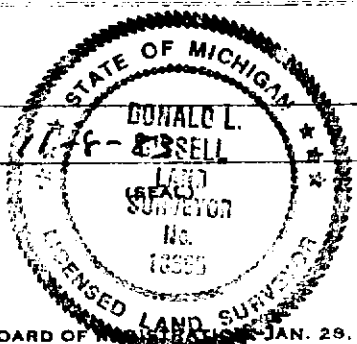

SURVEYOR'S MICHIGAN REGISTRATION NO. 18655