LAND	CORNER RECORDATION CERTIFICAT	E
Filina	Requirement of Act 74, Mich. P.A. 197	0

Corner Code ## <u>Livingston</u> Located In: I - 11T 1N R 6E 1. Public Land Survey $_{\mathsf{R}}$

2. Property Controlling _ T ___ R in Section

L.S.C.# 100m

Register of Deeds Stamp & File Number

_ , Recorded Plat _

5. Private Claims _

Miscellancous

Property in Sec.

For corners in

I.H. Lawrence O'Donnelell survey on . December 22, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO Survey in 1816 by Joseph Wampler Set post cor to Secs 26, 27, 34 & 35

49 1ks B. Oak 18 N58E W. Oak 14 S34W 26 1ks

(Additional historical data on back of sheet)

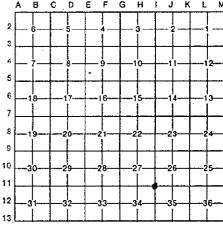

Break Case to all to bear in the line of

1993

COMMISSION

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" Iron Pipe 4.2' South of centerline of Nine Mile Road

3 Witnesses from LCS #849 verify this location

Description of monument for corner and accessories established to perpetuate locating the position of the corner;

Set 14" x 42" breakway Iron Pipe with Brass Cap in monument box

18" Oak M₀ 0 E N 37.78' to nail with/flasher 26" Oak N40 °E 40.48' to nail with/flasher

30.64' to nail with/flasher 32" Maple S50°W

30" Maple S30°W 26.24' to nail with/flasher

O'DONNELL **PROFESSIONAL** SURVEYOR

Date December 23, 1993

Burveyor's Michigan License No. .

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

Approved by Livingston County Monumentation Peer Group November 6, 1993 REVISED JAN., 1983

Civil Engineering • Surveying Planning • Environmental Services

ATWELL - HICKS, INC.

540 Avis Drive P.O. Box 2981 Ann Arbor, Michigan 48106 313 994 4000 • FAX: 313 994 1599

RESEARCH SUMMARY

I-11, NW Corner Section 35, T1N, R6E

Found 1/2" iron pipe at the location of the NW corner of Section 35.

Original GLO survey notes referenced set post corner to Sections 26, 27, 34 & 35 from which a black oak 18 in dia bears N58°E 49 lks A white oak 14 in dia bears S34°W 26 lks

Old county survey records show Isaac Teller in 1886 recorded a 10" red cedar S25°E 55lks (36.7) and a 12" hard maple S63°W 103 lks (68.5). Also, Miles Bullock in 1895 calls a witness for Cedar 12 size 54.

Records of both C. Garlock and P. Benton show a 1" x 40" iron rod set (surveyor unknown) witnessed by:
SW corner N. Sluice abutment NE'LY 13.5
6" Twin Oak NW'LY 25.2
12" Maple SW'LY 30.6
Centerline road S'LY 4.8

Corner is referenced in 1973 survey by Tredinnick; 1974 PA 74 by Tredinnick; 1974 PA 74 by Jagow; 1975 survey by Kostecke.

A search of the area found no other irons. I conclude that this iron pipe marks the location of the NW corner section 35 T1N, R6E.

