

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Livingston
(County)

Located In: _____ Corner Code ≠#

- | | | | | | |
|------------------------------------|---|-----------|---|-----------|-------------|
| 1. Public Land Survey | T | <u>1N</u> | R | <u>6E</u> | <u>M-13</u> |
| | T | _____ | R | _____ | _____ |
| | T | _____ | R | _____ | _____ |
| | T | _____ | R | _____ | _____ |
| 2. Property Controlling in Section | S | _____ | T | _____ | R |
| | S | _____ | T | _____ | R |
| 3. Miscellaneous Property in Sec. | S | _____ | T | _____ | R |
| | S | _____ | T | _____ | R |

9
FILED
 Dec 27 11 25 AM '93
 NANCY HAVILAND
 REGISTER OF DEEDS
 LIVINGSTON COUNTY, MI
 48843

L.S.C.# 109m

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, H. Lawrence O'Donnell, in a field survey on December 22, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO Survey November 1815 by Joseph Wampler
 Set post cor to T1S N & S, Ranges 6 & 7 East

- W. Oak 18 S65W 52 lks
- W. Oak 18 N20E 88 lks

(Additional historical data on back of sheet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1 1/2" Iron Pipe 2 feet deep, raised by 1/2" iron pipe. 1 1/2" iron pipe was set by W. Armstrong in 1936.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Raised 1 1/2" Iron Pipe with 1 1/4" Iron Pipe and Brass cap to 0.5' below road surface

- 8" Elm S20°W 65.42' to nail w/flasher
- 10" Pine N60°W 65.04' to nail w/flasher
- Utility Pole S55°E 56.88' to nail w/flasher
- Utility Pole N40°E 55.43' to nail w/flasher

| A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|----|----|----|----|----|---|---|---|---|---|---|
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | |
| 3 | | | | | | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | |
| 5 | | | | | | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | |
| 7 | | | | | | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | |
| 9 | | | | | | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | |
| 11 | | | | | | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | |
| 13 | | | | | | | | | | | | |

SURVEY &
 REMONUMENTATION
 1993
 COMMISSION

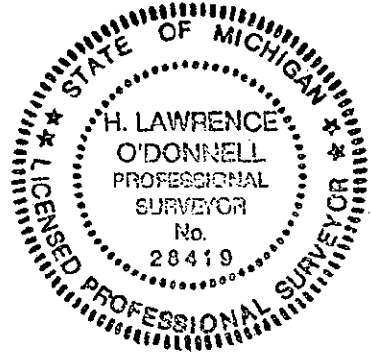

Signed by H. Lawrence O'Donnell Date December 23, 1993

Surveyor's Michigan License No. 28419

Approved by Livingston County Monumentation Peer Group October 30, 1993

Civil Engineering • Surveying
Planning • Environmental Services

A T W E L L - H I C K S , I N C .

540 Avis Drive
P.O. Box 2981
Ann Arbor, Michigan 48106
313 994 4000 • FAX: 313 994 1599

RESEARCH SUMMARY

M-13, SE Corner Section 36, T1N, R6E, Green Oak Township

Found 1 1/2" Iron pipe, 2' deep, raised by a 1/2" iron pipe, at the Township corner common to T1N, R6E; T1N, R7E; T1S, R6E and T1S, R7E. W. Armstrong (surveyor for W.C.R.C) set a 1-1/2"x30" pipe at this location in 1936. Corner referenced in 1943 survey by H.H. Atwell; 1957 survey by Atwell-Hicks, Inc.; 1971 survey by Geo. Kattouah; 1972 PA 74 by C. Wilson; 1973 survey by Geo. Kattouah; 1983 survey by H. Munzel; and 1988 survey by H. Munzel.

A search of the area found no other irons. I conclude that the iron (s) found marks the SE corner of Section 36 and the Township corner.



Mary A. Borkowski, RLA • William C. Henderson • Robert J. Jagow Jr., PE, PS • Robert G. Macomber, PE, PS
John L. Snyder, PE, PS • Allen R. Suggitt, PE • Richard G. Timmons, PE, PS