

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Livingston
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|-------------------------|-------------|
| 1. Public Land Survey | T <u>2N</u> R <u>3E</u> | <u>L-13</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

DEC 27 12 22 PM '93
 NANCY HAYLAND
 REGISTER OF DEEDS
 LIVINGSTON COUNTY, MI
 48843

FILED

L.S.C. #128m
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2				
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Darrell D. Hughes, in a field survey on December 17, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO: 1825
 Tamarack 9" N55½W 11½ lks.
 Tamarack 11" N53½E 34 lks.

REMOVED
 1993
 COMMISSION

*Additional historical information on back of sheet:


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Physical corner not found.
 Pro-rated measures of existing and computed co-ordinates of corners found and re-measured in Sections 35 & 36.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-13, T2N, R3E, TOSCO, set corner with 1-1/4" X 36" iron pipe, affixed with 2" dia. brass cap, stamped "Livingston Co. Monumentation Corner, P.S. 19834, 30" below grade in cultivated farm field, 50' E. of cl N/S ditch and is accepted as a careful and faithful reestablishment of the position of the original corner.
 275 DEG. 20.80' SET 1 1/4" X 36" IRON PIPE/BRASS DISK FOR N 1/4 COR. SEC. 1, T1N, R3E, UNADILLA. (L-1)
 230 DEG. 54.73' SET 1" X 36" IRON PIPE/ BRASS WIT. DISK.
 275 DEG. 39.79' SET 1" X 36" IRON PIPE/ BRASS WIT. DISK.
 317 DEG. 54.36' SET 1" X 36" IRON PIPE/ BRASS WIT. DISK.

Signed by Darrell D. Hughes Date December 27, 1993
 Surveyor's Michigan License No. 19834

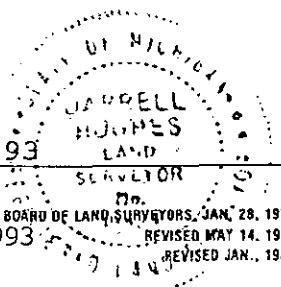

Approved by Liv. Co. Peer Group: December 11, 1993

IOSCO TOWNSHIP, T2N, R3E

L-13, SOUTH 1/4 CORNER SECTION 36

FIELD 10-27-1993 D.D.HUGHES AND ASSOCIATES, FOWLerville

Corner not found. Location falls in active farm field.
Corner is obliterated but not lost. The corner will be established by retracement of surveys by others.

1825, corner first set by Sylvester Sibley, Deputy U.S. Surveyor in "Tamarack swamp".

1861, E.N. Fairchilds, County Surveyor, divided Section 36.

1915, Grant Dunning, County Surveyor, retraced parts of section division.

1964, Lyle Munsell, shows relationship of L-13 Iosco and L-1 Unadilla. 20.8' apart and witnessed. No witness' remain now. Book 81, Page 51.

1976, Boss ran extensive traverse for all of Section 36 and into the East 1/2 of Section 35. All corners and 1/4 corners were either found or calculated and given coordinates.

1979, Garlock survey shows corner as 2" iron pipe, not witnessed. Shows measures to M-13.

1988, Boss shows division in Southeast 1/4, using this corner. No witness'. Shows measures to M-13 that agree with 1976 traverse.

Corner to be set, based on Boss (1976) section break-down and surveys in Section 36 and 35.

100