

SURVEY & REMONUMENTATION

FEB 25 1999

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

FILED

For corners in

LIVINGSTON

(County)

Located In:

Corner Code #

1. Public Land Survey

T 2N R 4E H5
 T ___ R ___
 T ___ R ___
 T ___ R ___
 S ___ T ___ R ___
 S ___ T ___ R ___
 S ___ T ___ R ___
 S ___ T ___ R ___

2. Property Controlling in Section

3. Miscellaneous Property in Sec.

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

91
 1998 AUG 20 P 4: 46
 NANCY HAVILAND
 REGISTER OF DEEDS
 LIVINGSTON COUNTY, MI.
 48843
 L.S.C. #890m
 Register of Deeds Stamp & File Number

CHARLES E GARLOCK, in a field survey on AUG 12, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

| | | | | | | | | | | | | | |
|----|----|---|----|---|----|---|----|---|----|---|----|---|---|
| | A | B | C | D | E | F | G | H | I | J | K | L | M |
| 1 | | | | | | | | | | | | | |
| 2 | 6 | | 5 | | 4 | | 3 | | 2 | | 1 | | |
| 3 | | | | | | | | | | | | | |
| 4 | 7 | | 8 | | 9 | | 10 | | 11 | | 12 | | |
| 5 | | | | | | | | | | | | | |
| 6 | 18 | | 17 | | 16 | | 15 | | 14 | | 13 | | |
| 7 | | | | | | | | | | | | | |
| 8 | 19 | | 20 | | 21 | | 22 | | 23 | | 24 | | |
| 9 | | | | | | | | | | | | | |
| 10 | 30 | | 29 | | 28 | | 27 | | 26 | | 25 | | |
| 11 | | | | | | | | | | | | | |
| 12 | 31 | | 32 | | 33 | | 34 | | 35 | | 36 | | |
| 13 | | | | | | | | | | | | | |

A. Description of original monument and accessories and/or subsequent restoration:

GLO SURVEY DATED APRIL 15, 1825 BY S SIBLEY

GLO WITNESSES: B010-S68E-37 LKS
 B014-N75W-67 LKS

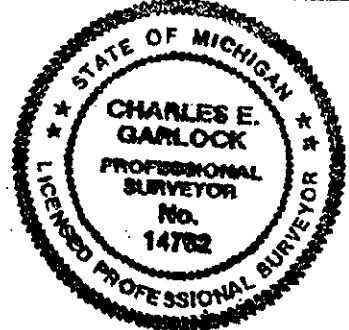

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" I. ROD IN OLD FENCE POST HOLE WITH REMAINS OF FENCE LINES TO THE NORTH, SOUTH EAST AND WEST.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

H5: N 1/4 COR. SEC. 15, T2N-R4E, MARION TWP. LIV. CO. MI; REPLACED 1/2" I. ROD WITH 1 1/4" X 36" I. PIPE WITH LIV. CO. REMON BRASS CAP ON TOP. AT +.40'
 S5E-40.86'-SP & TAG W/S 22" OAK
 S81E-23.01'-SP & TAG S/S OF SOUTH 7" TRIPLE OAKS
 N85W-19.25'-SP & TAG N/S 7" LOCUST
 N60E-1.77'-SP & TAG W/S 50" OAK

CORNER FALLS AT INTERSECTION OF MATURE TREE LINES IN RESIDENTIAL AREA.

Signed by Charles E. Garlock
 Surveyor's Michigan License No. 14762

Date AUGUST 13, 1998