

FILED

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

AUG 8 12 56 PM '94

For corners in  
Livingston  
(County)

Located In:	Corner Code #
T <u>2N</u> R <u>4E</u>	<u>M-11</u>
T _____ R _____	_____
T _____ R _____	_____
T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____

NANCY HAVILAND  
REGISTER OF DEEDS  
LIVINGSTON COUNTY, MI  
48843

L.S.C.#206M

Register of Deeds Stamp & File Number

- Public Land Survey
- Property Controlling in Section
- Miscellaneous Property in Sec.
- Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Charles E Garlock in a field survey on June 7, 1994, 19\_\_\_\_ do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:  
 GLO survey date: April 15, 1825 by S Sibley  
 GLO witness: W014-N79W-0.11 ch  
 W011-S6W-0.56 ch

see additional data on rear of sheet


- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 Found 1/2" I. rod in center of corner fence post hole rung with stones and fence lines North South and West, also found 1/2" I. rod North 63.95 feet for Genoa section corner, GLO jog = 64.02 feet. At point -1.5 feet found second 1/2" I. Rod that was 0.22 feet South and 0.45 feet West of found iron rod at surface in post hole; which is the older of the two.

**SURVEY &  
REMONUMENTATION**

SEP 26 1994

COMMISSION

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 M-11, SE corner Section 25, T2N-R4E, Marion Twp. Liv. Co. MI  
 Replaced the older of 2, 1/2" I. Rods with 1 1/4" X 36" I. Pipe and Liv. Co. REmon brass cap at +0.2'  
 N5E-8.13'-sp & tag W/s 34" W Oak  
 N45W-13.19'-sp & tag S/s 10" Hickory  
 S5W-9.17'-sp & tag E/s 8" Hickory  
 West-53.65'-sp & tag N/s 12" R Oak  
 N0rth-63.95'-SW cor. Sec. 25 T2N-R5E

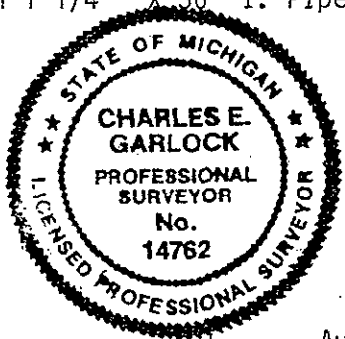

Signed by Charles E. Garlock Date August 1, 1994  
 Surveyor's Michigan License No. 14762

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN. 1983  
 P.A. 345 1980, APPROVED BY LIVINGSTON COUNTY  
 PEER GROUP ON 18 MAR 1994 CO. REP RL

