

SURVEY & REMONUMENTATION

MAR 17 2000

FILED

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

1999 NOV 22 A 11:07

For corners in
LIVINGSTON
(County)

Located in: **GENOA** Corner Code #

- | | | | |
|------------------------------------|-------------|-------------|-------------|
| 1. Public Land Survey | T <u>2N</u> | R <u>5E</u> | H-9 |
| | T _____ | R _____ | _____ |
| | T _____ | R _____ | _____ |
| | T _____ | R _____ | _____ |
| 2. Property Controlling In Section | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |
| 3. Miscellaneous Property In Sec. | S <u>22</u> | T <u>2N</u> | R <u>5E</u> |
| | S <u>22</u> | T <u>2N</u> | R <u>5E</u> |
4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

9

NANCY HAVILAND
REGISTER OF DEEDS
LIVINGSTON COUNTY, MI.
48843

LSC#1106m

Register of Deeds Stamp and File Number

004
005 ✓

I, Bryan L. Boss, in a field survey on NOV. 9, 1999
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefor as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

1/4 SECTION CORNER IN LAKE
NO POST OR MARKINGS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

CORNER POSITION ESTABLISHED ON STRAIGHT LINE BETWEEN CORNERS 6 AND 1-9 AT THE INTERSECTION OF THE N-S 1/4 LINE AS IDENTIFIED BY TWO MONUMENTS IN CONRAD'S SUBDIVISION, L.3, PG. 46 L.C.

THE CORNER POSITION IS PERPETUATED WITH TWO REFERENCE POINTS.

H-9 TO REF. PT. 1 N 86° 39' 21" E, 705.72'
H-9 TO REF. PT. 2 S 02° 24' 49" E, 732.08'
REF. PT. 1 TO 2; S 41° 05' 16" W, 1025.07'

REFERENCE POINT 1 IS A CONCRETE MONUMENT WITH A BRASS CAP STAMPED "MICHIGAN CONSERVATION DEPARTMENT" "PUBLIC FISHING SITE" IN EAST SIDE OF CROOKED LAKE NEAR LINE BETWEEN SECTION 22 & 27


REFERENCE POINT 2 IS A SET 1 1/4" X 36" PIPE W/BRASS CAP ON THE EAST LINE OF "CONRAD'S SUB" AND ON THE SOUTH LINE OF SKUSA DRIVE REPLACING THE PIPE FOUND AT THE NE CORNER LOT 38

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REFERENCE POINT 1 -- 004
FOUND CROSS IN BRASS CAP STAMPED "MICHIGAN CONSERVATION DEPARTMENT" "FISHING SITE" IN A 4" CONCRETE MONUMENT N5°W 17.42' SET REMON N/TAG E/S 12" POPLAR EAST 3.40' SET REMON NAIL/TAG N/S 6" R. OAK S10°W 25.73' SET REMON N/TAG E/S 16" BOX ELDER S85°W 9.96' SET REMON NAIL/TAG N/S 9" CHERRY

REFERENCE POINT 2 -- 005
SET 1 1/4" X 36" PIPE WITH BRASS CAP STAMPED LIVINGSTON COUNTY REMONUMENTATION WITNESS SOUTH 3.85' SET REMON NAIL/TAG E/S P. POLE EAST 27.78' SET REMON NAIL/TAG N/S 12" OAK N10°E 17.94' SET REMON NAIL/TAG E/S P. POLE N80°W 121.30' SET REMON NAIL/TAG S/S P. POLE

P.A. 348 1990, APPROVED BY LIVINGSTON COUNTY
PEER GROUP ON 9-15-99, CO. REP JED

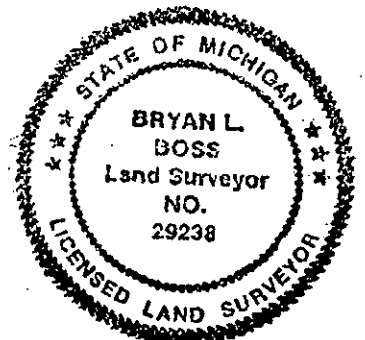

Signed by Bryan L. Boss

Date NOV. 11, 1999

Surveyor's Michigan License No. 29238