

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

JUL 14 9 46 AM '95

NANCY HAVILAND
 REGISTER OF DEEDS
 LIVINGSTON COUNTY, MI
 48843

For corners in Livingston (County) Located In: _____ Corner Code # _____

1. Public Land Survey	T <u>4N</u> R <u>4E</u>	<u>D-13</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

L.S.C. #416 m

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Edward E. Anderson a field surveyor on June 27, 1995 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. Notes dated June 20, 1823
 G.L.O. Witnesses B. Oak 14" N58°E, 88 Lks
 W. Oak 24" N86°W 137 Lks

Additional historical data on Back

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" rerod. Fit witnesses by Boss, Hughes and Shellenberger.


Edward E. Anderson
 11495
 COMMISSION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-13 S 1/4 COR. SEC. 32, T4N-R4E

Set 36" x 1 1/4" Breakaway iron pipe with Brass Cap (Liv. Co. Mon. Cor.)
 8' north of centerline Allen Road.
 N78°E 47.05' Spike S/S 16" Ash
 S60°E 68.58' Spike N/S 18" Ash
 S61°W 44.92' Spike E/S 24" Oak
 N40°W 16.27' Spike S/S 18" Beachnut

Signed by E. Anderson
 Surveyor's Michigan License No. 11495

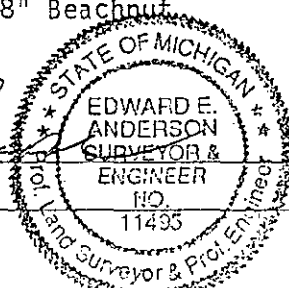

Date July 5, 1995

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983

P.A. 348 1990, APPROVED BY LIVINGSTON COUNTY
 PEEB GROUP ON 4-5-95 CO. REC 1512



EDWARD E. ANDERSON, P.S., P.E.
RICHARD F. FRANK, P.S.
BRIAN R. SHALTZ, C.S.T.

Members of:
Michigan Society of Professional Surveyors
American Congress on Surveying and Mapping
American Society of Civil Engineers

401 S. Leroy St.
Fenton, Michigan 48430-2164

(313) 629-8974
FAX (313) 629-9069

SUMMARY

March 21, 1995

D-13 SOUTH 1/4 CORNER, SECTION 32, T4N-R4E, COHOCTAH TOWNSHIP,
LIVINGSTON COUNTY, MICHIGAN.

Found 1/2" rerod, 8' north of centerline of Allen Road (gravel)

Checked and measured to witnesses we found. Found 3 of 4 Boss witnesses and they checked, Pages 11 and 12, this dossier. Found all of Hughes witnesses and they checked, Pages 19 and 25, this dossier. Found all of Shellenbargers witnesses and they checked, Pages 20 and 22, this dossier.

Distance from the South 1/4 corner to the S.W. corner of said Section 32 is 2646.33' on Boss and Hughes surveys, Pages 9, 18, 19, and 24, this dossier; and 2646.59' on Hughes survey, Page 24 this dossier.

Distance from the South 1/4 corner to the S.E. corner of said Section 32 is 2642.12' on Shellenbarger surveys, Pages 20, 21, and 22, this dossier and 2642.42 on Benton Survey, Page 13 this dossier.

Make a clean sweep of the immediate area and found no other corners or irons.

Gravel roads running East and West. Road flat to the East and rises to the West.

Terrain is open to the North and South. House to the north. No occupation lines to the north or south.

Not good location for G.P.S.

Came to the conclusion that the 1/2" rerod we found is the correct South 1/4 Corner of said Section 32.

E. Anderson
Edward E. Anderson
P.S.#11495

