

OCT 26 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

SEP 15 12 02 PM '95

Filing Requirement of Act 74, Mich. P.A. 1970

NANCY HAVILAND  
REGISTER OF DEEDS  
LIVINGSTON COUNTY, MI  
48048

For corners in

Livingston  
(County)

Located in:

Corner Code #

- 1. Public Land Survey T 4 N R 6 E D-13  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
- 2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

L.S.C.# 431m

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	6	5	4	3	2	1						
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Edward E. Anderson, in a field survey on July 27, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO NOTES DATED April 5, 1823  
GLO WITNESSES W. Oak 12" N60°E 27 Lks  
W. Oak 12" S60°W 11 Lks

ADDITIONAL HISTORICAL DATA ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found 1/2" rerod. Fit witnesses by Munzel, Albright, and Benton

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-13 S 1/4 SEC 32 T4N-R6E  
Set 1 1/4" 36" breakaway iron pipe with brass cap (Liv. Co. Mon. Cor)  
in mon box 5' south of centerline Parshalville Road  
N50°E 44.63' Spike W/S 18" Sycamore  
S57°E 49.50' Spike N/S 18" Hickory  
S77°W 57.48' Spike N/S 30" Apple  
N41°W 47.42' Spike N/S 15" Hickory

Signed by E. Anderson Date August 1, 1995

Surveyor's Michigan License No. 11495

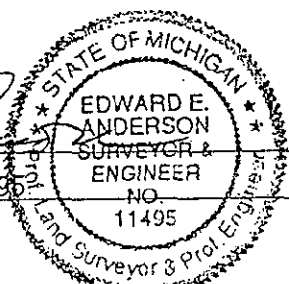

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1993

P.A. 345 1990, APPROVED BY LIVINGSTON COUNTY  
PEER GROUP ON 6-7-95 CO. REP LED



EDWARD E. ANDERSON, P.S., P.E.  
RICHARD F. FRANK, P.S.  
BRIAN R. SHALTZ, C.S.T.

Members of:  
Michigan Society of Professional Surveyors  
American Congress on Surveying and Mapping  
American Society of Civil Engineers

401 S. Leroy St.  
Fenton, Michigan 48430-2164

(313) 629-8974  
FAX (313) 629-9069

SUMMARY

May 3, 1995

D-13 SOUTH 1/4 CORNER SECTION 32, T4N-R6E, TYRONE TOWNSHIP, LIVINGSTON COUNTY, MICHIGAN.

Found 1/2" rerod 5'  $\pm$  south of the centerline of Parshalville Road (Black top).

Checked and measured to witnesses we found.

Found all of Munzel, Albright and Benton witnesses and they checked, pages 9, 11, 12, 13 and 17 this dossier.

Distance from S 1/4 corner to the S.W. corner of said Section 32 is 2612.59' on Benton survey, page 12 this dossier.

Distance from the S 1/4 corner to the S.E. corner of said Section 32 is 2640.51', being a combination of a distance on Boss survey and a measured distance by E. Anderson, pages 14, 15, 16, 20, 21, and 23 this dossier.

Made a clean sweep of the immediate area and found no additional iron or corners.


Paved road running east and west. Road rises to the west and falls to the east.

Terrain is open to the N.E. and south. wooded to the northwest. Old fence and tree line running to the north. House to the south and to the northwest.

Poor location for G.P.S.

Came to the conclusion that the 1/2" rerod we found is the correct S 1/4 corner of said Section 32.

Edward E. Anderson  
P.S.#11495

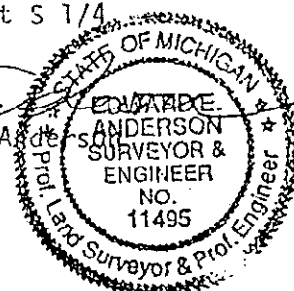

T4N R6E D-13 PS 4