

OCT 26 1995

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SEP 15 12 02 PM '95

For corners in

Livingston
(County)

Located In:

Corner Code #

HANGY HAVILAND
REGISTER OF DEEDS
LIVINGSTON COUNTY, MI
48843

- 1. Public Land Survey T 4 N R 6 E E-12
T _____ R _____
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Section S _____ T _____ R _____

L.S.C.# 433m

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Edward Anderson, in a field survey on August 5, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO NOTES DATED APRIL 5, 1823
GLO WITNESSES OAK 10" S12°W 18 Lks
SWAMP OAK N4°W 29 Lks

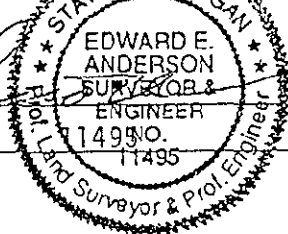
ADDITIONAL HISTORICAL DATA ON BACK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND P.K. FIT WITNESSES BY STATE, HIGHWAY DEPARTMENT

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-12 E 1/4 COR SEC 32 T4N-R6E
SET 1 1/4" x 36" BREAKAWAY IRON PIPE WITH BRASS CAP (LIV. CO. MON. COR.)
IN MONUMENT BOX IN CENTERLINE OF OLD U.S. 34
N58°E 26.16' 1" x 36" witness post
S39°E 30.40' 1" x 36" witness post
S78°E 66.19' Spike N/S 16" Maple
N46°W 67.51' Spike N/S 14" Twin Oak

Signed by [Signature]
Surveyor's Michigan License No. _____


Date August 14, 1995

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983

PA. 345 1980, APPROVED BY LIVINGSTON COUNTY
FEET GROUP ON 6/2/95 CO. REP JEO



EDWARD E. ANDERSON, P.S., P.E.
RICHARD F. FRANK, P.S.
BRIAN R. SHALTZ, C.S.T.

Members of:
Michigan Society of Professional Surveyors
American Congress on Surveying and Mapping
American Society of Civil Engineers

401 S. Leroy St.
Fenton, Michigan 48430-2164

(313) 629-8974
FAX (313) 629-9069

SUMMARY

June 8, 1995

E-12 EAST 1/4 CORNER OF SECTION 32, T4N-R6E, TYRONE TOWNSHIP,
LIVINGSTON COUNTY, MICHIGAN

Found P.K. nail with tag in the centerline of old US-23 (service road) Black top pavement).

Checked and measured to witnesses we found. Found all of Flint Surveying witnesses, and they checked, page 8 this dossier.

Distance from the E 1/4 corner to the SE corner of said Section 32 is 2676.32' on Flint Surveying, page 8 this dossier, and 2677.36' as measured in field by E. Anderson on 6/6/95, pages 6 and 13 this dossier.

Distance from the E 1/4 corner to the N.E. corner of said Section 32 is 2680.60' as measured in the field by E. Anderson on 4/27/95, pages 6 and 13 this dossier. Measured from the PK nail with tag west to a capped 1/2" rerod (#9189 Carlson), and it measured 78.98'. This iron fell 0.2' east of a wood and metal corner fence post. Old wire fence running south and west from this corner. M.D.O.T. construction plan shows the distance as 79.00', page 10 this dossier.

Made a clean sweep of the immediate area and found no additional irons or corners.

Black top road running north and south, flat in both directions.

Terrain is open to the east and southwest, wooded to the northwest. Old fence and treeline to the west.

Good location for G.P.S.

Came to the conclusion that the P.K. nail ^{with} tag we found is the correct E 1/4 corner of said Section 32.

Edward E. Anderson
P.S. #11495

