

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970
 Mackinac Co. *Mack* Two Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> ^{N.} S. , R. <u>11</u> ^{E.} W.	G-13 F-13
2. PROPERTY CONTROLLING IN SECTION _____	T. _____, S., R. _____, E. _____, W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____, S., R. _____, E. _____, W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 4-19 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- G-13 Sec. Cor. 33-34, on South Boundary of Twp., common to Sec's. 3-4, T41N R11W, set by John Burt, D.S. in 1845.
Bearings were: Y. Birch 14", N52°W, 22 lks. and Y. Birch 22", N37°E, 63 lks.
- F-13 Quarter Corner on South side Sec. 33, set by John Burt, D.S. in 1845.
Bearings were: Beech 18", N80°W, 42 lks. and Beech 12", N19°E, 5 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- G-13 Placed corner at a Fence Corner, no other evidence available.
- F-13 Placed corner midway and on line bet. two Section Corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Placed 1" pipe with 4" aluminium cap at both corners.
- G-13 New Bearings: 8" Aspen, S35°E, 53.5' and 8" Aspen, S76°E, 35.1'
- F-13 New Bearings: 10" S. Maple, S13°W, 29.7' and 8" S. Maple, S77°E, 35.3'

SIGNED BY Billy D. Buckler DATE 5-3-74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

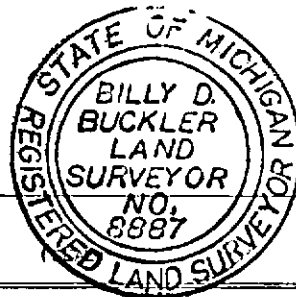

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____