

**SURVEY & REMONUMENTATION**

MAR 13 1998

**MACKINAC COUNTY REMONUMENTATION CORNER**

**SECTION**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Mackinac</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>42N</u> R <u>3W</u>	<u>K-5</u>
	T <u>    </u> R <u>    </u>	<u>Common to</u>
	T <u>    </u> R <u>    </u>	<u>Sec's 11-12-13-14</u>
	T <u>    </u> R <u>    </u>	_____
	T <u>    </u> R <u>    </u>	_____
2. Property Controlling in Section	S <u>    </u> T <u>    </u> R <u>    </u>	_____
	S <u>    </u> T <u>    </u> R <u>    </u>	_____
3. Miscellaneous Property in Sec.	S <u>    </u> T <u>    </u> R <u>    </u>	_____
	S <u>    </u> T <u>    </u> R <u>    </u>	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

RECEIVED & FILED  
DIANE BRAD KIRCH  
MACKINAC COUNTY REGISTER OF DEEDS  
DEC 29 1997  
AM P.M.  
11-21-97

Register of Deeds Stamp & File Number

I, Neil E Hill, in a field survey on DEC 22, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

- A. Description of original monument and accessories and/or subsequent restoration:
- 1840 GLO notes William Burt 7" Aspen S54E 11 lks  
5" Aspen N20W 17 lks
  - 1957 MDOT prints
  - 1973 Ostling survey Liber 2, page 23
  - 1994 G. Koepke, MDOT, found cap by State of Michigan  
Recorded Liber D, page 329

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- 1997 Found 4" brass cap with State of Michigan stamping in monument box ring accepted Corner as found. (Old witnesses)
  - North 194.42' Drillhole in top center of concrete R/W Marker
  - East 152.02' Drillhole in top center of concrete R/W Marker
  - South 48.43' Drillhole in top center of concrete R/W Marker
  - West 37.61' Drillhole in top center of concrete R/W Marker
  - N60E 122.61' 11" W. Birch Nail with MDOT Reference Tag
  - N80E 155.85' Power Pole Nail with brass tag
  - S75W 37.66' 10" Cedar Nail with MDOT Reference Tag
  - N70W 40.04' 10" W. Birch Nail with 16041 Tag

ACCEPTED BY THE MACKINAC COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER PA. 345 OF 1990 AT A MEETING HELD ON 11-21-97

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- 1997 Found 4" brass cap with State of Michigan stamping in monument box ring.
  - North 194.42' Drillhole in top center of concrete R/W Marker
  - East 152.02' Drillhole in top center of concrete R/W Marker
  - South 48.43' Drillhole in top center of concrete R/W Marker
  - West 37.61' Drillhole in top center of concrete R/W Marker
  - N60E 122.61' 11" W. Birch Nail with MDOT Reference Tag
  - N80E 155.85' Power Pole Nail with brass tag
  - S75W 37.66' 10" Cedar Nail with MDOT Reference Tag
  - N70W 40.04' 10" W. Birch Nail with 16041 Tag

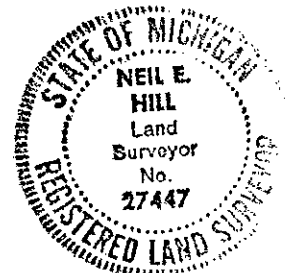

Signed by Neil E Hill P.S. Date DECEMBER 22, 1997  
Surveyor's Michigan License No. 27447