

13

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Mackinac

(County)

Located In: Corner Code #

1. Public Land Survey

T 43N R 1W D9

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Register of Deeds Stamp & File Number

Jul 08 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4		3		2		1	
3													
4	7			8		9		10		11		12	
5													
6	18			17		16		15		14		13	
7													
8	19			20		21		22		23		24	
9													
10	30			29		28		27		26		25	
11													
12	31			32		33		34		35		36	
13													


A. Description of original monument and accessories and/or subsequent restoration.
(D9) Quarter corner common to Sections 20-29. Corner established in 1845 by James Mullett: "...40.03 1/2 Set quarter section post. Beech 8 S43W 25, do. 8 N76E 27". Original random line notes from the west show: "15.50 Spring Brook 14 C. Northerly".

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(D9) Original post and accessories not recovered. Found no acceptable evidence of the position of the original corner on the ground. A spring brook, matching the description in the original record, was found 1650' West of the position determined for this corner (27' longer than record). I was reluctant to rely upon the random line notes of this particular deputy surveyor for the determination of the original corner position and, therefore, did not regard the stream call as acceptable evidence of the position of the corner. Determined the original corner to be lost and reestablished the corner by single proportionate measurement to the original record, on a line of mean true bearing between Section corners 2673.57 ft. east and west. At the position for the corner, I placed a 1"IDx36" iron pipe capped with a 4" dia. cast aluminum MDR tablet, appropriately stamped. Corner placed and witnessed by T. Stark and D. Lampela, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(D9) Placed 1" pipe with 4" MDR cap.
Blazed, scribed, and set measuring nails in the following:
12" Maple S58E 15.85' "1/4S NBT"
14" Maple S17W 18.0' "1/4S NST"
5" Maple N45W 41.15' "1/4S NBT"
8" Maple N58E 25.85' "1/4S NST"
Placed a 4" squared and scribed cedar post adjacent. The monument can be found on the south side of an E-W trail rd. Bearings are magnetic.

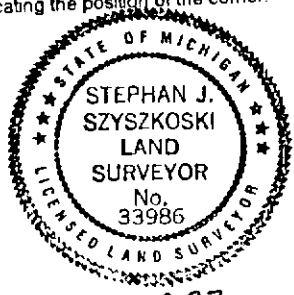

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 1-28-97