

FEB 18 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located In:

Corner Code #

- | | | | | |
|------------------------------------|---|-------------|-----------|------------|
| 1. Public Land Survey | T | <u>43NR</u> | <u>5W</u> | <u>G-1</u> |
| | T | _____ | _____ | _____ |
| | T | _____ | _____ | _____ |
| | T | _____ | _____ | _____ |
| 2. Property Controlling in Section | S | _____ | _____ | _____ |
| | S | _____ | _____ | _____ |
| 3. Miscellaneous Property in Sec. | S | _____ | _____ | _____ |
| | S | _____ | _____ | _____ |

RECEIVED & FILED
DIANE FRAP NOVICH
MACKINAC COUNTY CLERK OF DEEDS

DEC 07 1993

AM PM
7[6]9[1]0[1]1[1]2[1]3[1]4[1]5[1]6

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Neil E. Hill

October 1 93

I, _____, in a field survey on _____, 19 _____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1845: Corner positions were established H. Brevoort, Jr. Set a wood post and 2 reference trees.
- 1937: Re-established by G.L.O. dependent resurvey of T44N, R05W. Recovered portion of original stake and more recent stake 4" square, 4' high, scribed S.3 and S.4 on SE and SW faces.
- 1982: Iron post 3'x1" diam. upper portion encased in concrete 24"x6" diam. 27" in ground, with brass tablet embedded in top, stamped to identify the corner. References:
8" Elm N16E 59 links
Corner fence post S29E 35 links

B. Description of corner evidence found and method applied in restoring or reestablishing corner:

- 1982: Monument recovered 18" below surface. GLO reference recovered:
19" Elm (dead snag) N16E 39.26 feet (59.5 links)
Position was also checked from standard corner 33-34, T44N, R5W, West, 10.48 feet (28 links) as recorded in 1937 GLO field notes. Position was accepted as found.
- 1982: Monument left as recovered. Established following references of which bearing trees are blazed, scribed "BT", tagged and painted, taken to centerline of tree or pole:
13" S. Maple S35W 82.19 feet Utility pole EK3-295-30 S12E 163.2 feet
8" Elm N21W 101.8 feet Std. cor. monument S33-S34W 18.48 feet


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 1993: Monument left as recovered. Verified references of which bearing trees are blazed, scribed "BT", tagged and painted, taken to centerline of tree or pole:
13" S. Maple S35W 82.19 feet Utility pole EK3-295-30 S12E 163.2 feet
8" Elm N21W 101.8 feet Std. cor. monument S33-S34W 18.48 feet
- 1993: Found an iron post 3'x1" diam. upper portion encased in concrete 24"x6" diam. with brass tablet embedded in top, stamped to identify the corner.
Established additional references:
Red post East 3'
Did not locate Std. cor. monument
Upon review, the location and witnesses for the corner as recorded in Liber B-343 (Corner Records), are sufficient to perpetuate the corner location.

Signed by Neil E. Hill P.S.P.C. Date October 15, 1993

Surveyor's Michigan License No. 27447

Remonumentation Surveyor

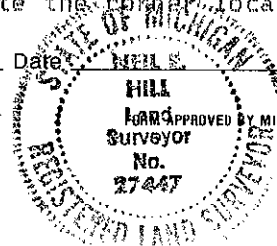

D-0232