

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

5 Corners

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. <u>8</u> W.	G-3, G-5, G-2, G-4 G-6
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ E. S. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. S. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 11-26, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- G-3 Sec. Cor. 3-4-9-10.
- G-5 Sec. Cor. 9-10-15-16.
- G-2 1/4 Cor. bet. Sec's. 3-4.
- G-4 1/4 Cor. bet. Sec's. 9-10
- G-6 1/4 Cor. bet. Sec's. 15-16.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-3 Moved corner 74.15' North of former position.
- G-5 Moved corner 49.43' North of former position.
- G-2 Moved corner 87.21' North of former position.
- G-4 Moved corner 61.79' North of former position.
- G-6 Moved corner 37.08' North of former position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- 1" pipe with 4" aluminum cap at all corners. New Bearings:
- G-3 11" W. Birch, S40°W, 5.2' & 8" E. Spruce, S15°E, 21.0'.
 - G-5 8" Cedar, S22°E, 64.8' & 8" Cedar, N4°W, 45.9'.
 - G-2 8" Cedar, N61°W, 14.8' & 6" Cedar, S22°W, 1.3'.
 - G-4 8" Cedar, N23°W, 6.2' & Twin Cedar, S34°W, 4.5'.
 - G-6 6" Cedar, S57°W, 12.0' & 6" Cedar, N23°E, 9.3'.

SIGNED BY *Billy D. Buckler* DATE 8-3-81
Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

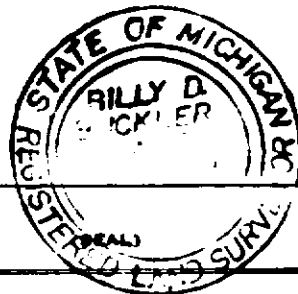

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____