

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

2 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>43</u> N. S. R. <u>8</u> X. W.	<u>D-7, E-9</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-1 & 4-3, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- D-7 Quarter Corner between Sections 17-20, set by H. Brevoort, Jr. D.S. in 1845.**
Bearings were: Hemlock 8, S3°W, 12 lks. and Pine 18, N8°E, 16 lks.
- E-9 Section Corner 20-21-28-29, set by H. Brevoort, Jr. D.S. in 1845.**
Bearings were: Birch 12, S76°E, 31 lks. and Maple 10, S47°W, 41 lks.


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- D-7 Replaced corner from original Pine Witness. Found remains of notch and old burned face. Distance fits fair to Corners East and West.**
- E-9 Re-witnessed corner as set 4-30-68. Corner had been perpetuated by Marcuss Schaaf R.L.S.**

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- D-7 Placed 1" pipe with 4" aluminium cap at corner.**
New Bearings: 14" W. Birch, S20°E, 26.4' and 12" W. Birch, S63°W, 33.1' and Twin 10" W. Birch, N74°E, 23.2'.
- E-9 Found pipe with cap broken.**
New Bearings: 6" Spruce, N72°W, 83.0' and Sq. Post on pipe line, N3°W, 81.7'.

SIGNED BY Billy D. Buckler DATE 9-8-78
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

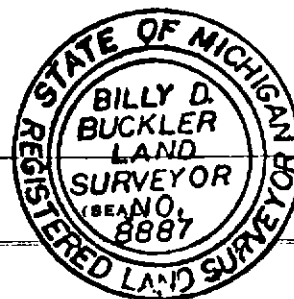

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____