

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

MACKINAC CO.

4 CORNERS

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 43 N. R. 12 E.	1-17
2. PROPERTY CONTROLLING IN SECTION 23	T. 43 N. R. 12 E.	4, 5, 8
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Gerald L. Wiggins, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-25, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- 1-J7 M.C. on West side of Browns Lake on North line of Sec. 23. OBT'S: Spruce 8, S34°W, 7 lks.
Cedar 6, S8°W, 45 lks.
- 4 N.W. 1/16 Corner of Section 23. Not prev. set.
- 5 Witness Corner 40.63' East to North 1/16 Corner of Section 23. Not prev. set.
- 8 West 1/16 Corner of Section 23. Not prev. set.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 1-J7 Corner set on North Sec. Line of Sec. 23 on West side of Browns Lake, 1269.93' East of the N.W. Sec. Cor. of Sec. 23.
- 4 Cor. set at center of NW¼ of Sec. 23 by closed traverse.
- 5 Cor. set on North 1/16 Line of Sec. 23, on West side of Browns Lake by closed traverse.
- 8 Cor. set M.P.O.L. between West ¼ Cor. and Center Cor. of Sec. 23.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner **DNR MONUMENTS**

- | | | | |
|------|----------------------------|---|----------------------------|
| 1-J7 | 7" Cedar, N75°E, 4.2' | 5 | 9" W. Birch, N88°W, 40.9' |
| | 6" Cedar, S24°E, 19.5' | | 8" Cedar, N03°E, 21.5' |
| | 8" Cedar, West, 10.4' | | 8" Cedar, N70°E, 16.2' |
| | 7" Cedar, N60°E, 16.8' | | 7" Cedar, S25°E, 16.3' |
| 4 | 10" W. Birch, S12°E, 34.1' | 8 | 14" R. Maple, N42°E, 28.8' |
| | 12" Cedar, S86°E, 33.8' | | 7" R. Maple, S30°E, 27.3' |
| | 7" Cedar, N23°W, 25.6' | | 12" H. Maple, S60°W, 24.4' |
| | 12" Cedar, N40°E, 19.0' | | 12" H. Maple, N48°W, 33.1' |


SIGNED BY

Gerald L. Wiggins
Gerald L. Wiggins

DATE 9-10-86

SURVEYOR'S MICHIGAN REGISTRATION NO.

23521

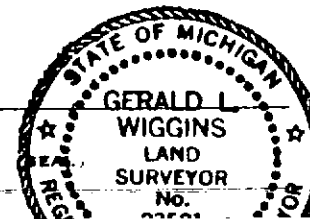

FOR STATE AND UNITED STATES AGENCIES.